

1 **Factors influencing development of cracking-sliding failures of loess across the eastern** 2 **Loess Plateau of China**

3 Yanrong Li¹, Jiarui Mao², Xiqiong Xiang², Ping Mo¹

4 ¹Department of Earth Sciences and Engineering, Taiyuan University of Technology, Taiyuan,
5 030024, China

6 ²Guizhou University, Guiyang, 550025, China

7 *Correspondence to:* Yanrong Li (li.dennis@hotmail.com) & Xiqiong Xiang (tujia@126.com)

8 **Abstract:** Loess is a porous, weakly cemented, and unsaturated Quaternary sediment deposited
9 by the wind in arid and semiarid regions. Loess is widely and thickly distributed in China,
10 making the Loess Plateau the largest bulk accumulation of loess on Earth. However, the fragile
11 geoenvironment in the loess areas of China causes frequent and various geohazards, such as
12 cracking–sliding failure (“beng-hua” in Chinese), which is a typical **geohazard** that causes the
13 largest number of casualties each year. This study investigates the main influencing factors and
14 development patterns of cracking–sliding failure of loess to help prevent its occurrence and
15 reduce losses effectively. The following conclusions are derived: (1) cracking–sliding failures
16 mostly take place in rectilinear slopes, convex slopes, slopes with gradients greater than 60°,
17 slopes with heights of 5 m to 40 m, and **slopes mostly exposed to sunlight** with aspects of 180° to
18 270°; (2) cracking–sliding failures occur mostly from 10 pm to 4 am and mainly in the rainy
19 season (July to September) and in the freeze–thaw season (March to April); and (3) highly
20 intense human activities in the region correspond to a high possibility of cracking–sliding
21 failures.

22 **Keywords:** loess, cracking–sliding failure, influencing factors, development patterns

23 **1 Introduction**

24 Any yellowish, carbonate-bearing, quartz-rich, silt-dominated strata formed by aeolian
25 deposition and aggregated by loessification during glacial times are widely **defined** as loess
26 (**Richthofen, 1882; Pye, 1987**). Loess (“huang-tu” in Chinese) and its related deposits are one of
27 the most widespread Quaternary sedimentary formations, and they are most abundant in arid or
28 semiarid regions in inner Eurasia and North America; they are characterized by high porosity,
29 weak cementation, and unsaturation (Samalley et al., 2011).

30 The Loess Plateau in China (LPC) **is** the main **region** for comprehensive development of
31 agriculture, forestry, animal husbandry, and industrial resources with an arable land area of
32 173,000 km², which accounts for more than one-fifth of the entire arable land of the country and

33 feed more than 200 million people (Zhang, 2014). However, geohazards, such as
34 cracking–sliding, toppling, falling, sliding, peeling, and failures of cavity built by human, occur
35 frequently because of fragile geological and natural environments, excessive reclamation, and
36 unreasonable engineering activities. Among these geohazards, cracking–sliding failure, normally
37 with a volume of several hundred cubic meters, causes the largest number of casualties in the
38 eastern LPC (Lei, 2001). More than 1000 cracking–sliding failures were recorded in the past two
39 decades, and they caused an average of more than 100 fatalities per year despite the small
40 volumes of individual failures. Unlike “flows” or “slides” as defined by Cruden and Varnes
41 (1996), cracking–sliding failures have composite failure planes composed of two parts. The
42 upper part normally develops vertically from the crown of the slope down for one to several
43 meters deep. The upper part forms by tensile cracking, but the slope can stand stably for a long
44 time with such cracks. The lower part is generally inclined at an angle ranging from 15° to 60°.
45 Sliding along the lower part, which is triggered by rainfall, freezing–thawing, daily temperature
46 fluctuations, slope undercutting, and earth tremors likely mobilizes cracking–sliding failures.

47 According to historical records, 62 cracking–sliding failures occurred in Shenmu, Mizhi,
48 Zizhou, and other sites in Northern Shaanxi Province from 1985 to 1993 and caused 258 deaths
49 and more than 40 injuries (Qu et al., 2001). In 2005, the cracking–sliding failure in Jixian County
50 in Shanxi Province resulted in 24 deaths and economic losses of approximately RMB 10 million.
51 Failure with a volume of $2.5 \times 10^4 \text{ m}^3$ took place in Zhongyang County in Shanxi on November
52 16, 2009, causing 23 deaths and destroying 6 houses. In 2013, 36 loess failures were documented
53 in Tianshui City, Gansu Province (Xin et al., 2013). In 2015, a cracking–sliding failure in
54 Linxian County, Shanxi buried four families comprising nine people. All of these failures
55 developed within the loess–paleosol sequence, with relatively uniform mineralogical and
56 chemical compositions. More recently, a cracking–sliding failure occurred in Shilou County of
57 Shanxi Province on March 10, 2018, and destroyed 36 houses (Fig. 1). The original loess slope
58 was characterized by slope gradient of 60°, height of 50 m and aspect of 280°. The scarp of this
59 failure was dominated by near-vertical tensile cracks with average gradient of 85°. The displaced
60 mass reached 7600 m^3 .

61 Frequent and disastrous events demand an in-depth understanding of causative factors and
62 development patterns of loess failures to reduce the occurrence of such geohazards. This study
63 collects a large set of data on loess cracking–sliding failures, climate, and soil temperature to
64 facilitate a detailed analysis of the internal and external causes of such failures. This study also
65 emphasizes the influences of slope features (i.e., slope type, gradient, height, and aspect), rainfall,
66 freezing–thawing cycles, daily temperature fluctuations, and human engineering activities.

67 2 Study area

68 The study area is limited to the eastern LPC and covers Northern Shaanxi and Western
69 Shanxi provinces, considering the homogeneous background of climatic, morphologic, geologic,
70 and anthropic conditions in these regions (Fig. 2). Elevation of the study area ranges from 800 to
71 1300 m above sea level from southeast to northwest. The study area has a typical semiarid
72 continental monsoon climate with four distinct seasons. The average annual rainfall in this area
73 varies from 400 to 700 mm. Rainfall in summer (from July to September) accounts for
74 approximately 70% of the year (Hui, 2010; Qian, 2011; Zhu 2014). For instance, the maximum
75 precipitation in an hour in Yan'an City can accumulate to more than 60 mm in summer (Zhu,
76 2014). The total rainfall in Shilou County reached 412 mm in a month from early July to early
77 August in 2013 (Lv, 2011) and corresponded to 81% of rainfall in the same year. According to
78 records for the past 10 years, the average annual temperature is relatively constant, ranging from
79 8 °C to 12 °C. However, variations in temperature in a day can occasionally be higher than 25 °C,
80 the highest temperature being recorded at noon and the lowest temperature at midnight.

81 The study area is located in the east of the Ordos basin. The Fenwei Graben, spanning
82 northeast to southwest, is a tectonic depression encountering a number of normal and strike-slip
83 faults and covering more than 20,000 km² (Huang et al., 2008; Liu et al., 2013). The thickly
84 bedded Pleistocene loess-paleosol sequence constitutes more than 70% of the study area and
85 reaches a maximum thickness of 300 m. From top to bottom, the loess-paleosol sequence
86 includes Late Pleistocene Malan Loess (Q₃), Middle Pleistocene Lishi Loess (Q₂), and Early
87 Pleistocene Wucheng Loess (Q₁). The Malan Loess, with thickness ranging from 10 m to 30 m,
88 is the most widespread. The Lishi Loess, with several to tens interlayers of loess and paleosol,
89 underlies the Malan Loess and forms a 60–150 m thick layer. The Wucheng Loess is
90 sporadically exposed along some loess gullies. Remarkable landforms, such as loess platforms,
91 ridges, and hillocks, have been formed in the study area because of intensive surficial erosion
92 (Zhang, 1983, 1986). Loess platforms are mainly distributed in the Luochuan area in Northern
93 Shaanxi Province; loess ridges are mainly found in the peripheries of the Luochuan platform and
94 the eastern regions of the Yellow River; and loess hillocks are mainly located in Yan'an, Suide
95 and in both sides of the Yellow River between Shaanxi and Shanxi provinces.

96 3 Dataset

97 A large set of data of loess cracking-sliding failure events were collected from published
98 literature and unpublished reports by local governments. Slope profile, gradient, height and
99 aspect, were derived in polygon from the initiation areas. The initiation areas rather than the
100 whole landslides were compared in the following statistical analysis. The polygons were
101 obtained by means of 1) interpretation of remote sensing images which were taken prior to the
102 event; 2) engineering documentation if the host slope was engineered; or 3) post-event field
103 survey and consultation with the local population. The field survey was normally conducted
104 within 1–2 days immediately after the event. A total of 1176 cracking-sliding events were

105 recorded in the past 20 years across the study area. Of these events, 321 were published in the
106 literature, 670 were presented in government reports, and 185 were unpublished. All of the 1176
107 failures were individually reviewed by verifying the reliability, accuracy, and completeness of
108 the original records. Finally, 458 cases (red dots in Fig. 2) were selected to set up the dataset for
109 this study by considering the completeness of the records of any type.

110 Data pertaining to rainfall were obtained from the records of 75 meteorological stations (blue
111 dots in Fig. 2), which are almost uniformly distributed across the study area. Statistical analysis
112 shows that the variation in average annual rainfall in the past 15 years among these stations is
113 less than 80 mm, indicating a relatively homogeneous climatic condition over the study area.

114 4 Results and discussion

115 4.1 Internal factors

116 Loess slopes are divided into four types in terms of slope profile: rectilinear, convex, concave,
117 and stepped slopes (Table 1). Concave and stepped slopes are more stable than the rectilinear and
118 convex slopes. We surveyed 212 loess slopes in Lishi City in Shanxi Province and found that
119 stepped slopes, convex slopes, rectilinear slopes, and concave slopes account for 38%, 31%, 18%,
120 and 13% of all slopes, respectively (Fig. 3a). This finding is consistent with the conclusion of
121 Qin et al. (2015), who performed a field survey on loess slopes in Yan'an City, Shaanxi Province.
122 However, approximately one-half of cracking–sliding failures occur in rectilinear slopes. In Fig.
123 3b, the statistical analysis of the 458 failure cases indicates that rectilinear slopes are the most
124 susceptible to cracking–sliding failure (48%), followed by convex slopes (28%). Stepped (13%)
125 and concave (11%) slopes are the least susceptible to such failures.

126 In general, the overall gradients of rectilinear and convex slopes are steep, resulting in large
127 internal stresses and stress concentrations, particularly at the shoulder and toe sections (Table 1).
128 The bottom part of the concave slope has a gentle gradient and has a supporting function to the
129 steep upper part, thereby relieving the stress concentration; the maximum shear stress at the foot
130 of concave slopes is typically only one-half of the shear stress at the foot of rectilinear slopes
131 (Zhang et al., 2009). The stress distribution pattern in each step section of a stepped slope is
132 similar to that of a rectilinear slope. However, the magnitude of internal stress of stepped slopes
133 is lower than that of rectilinear slopes because of the small height of each step and the gentle
134 overall gradient. These findings explain that most cracking–sliding failures occur in rectilinear
135 slopes, although these slopes are not the dominant slope type in the loess area.

136 In addition to slope profile, the gradient, height, and aspect of loess slopes are closely related
137 to the occurrence of cracking–sliding failures. Figure 4a shows that failure occurs mostly on
138 slopes with gradients greater than 60° and that the number of failures increases with gradients.
139 Of the cracking–sliding failures, 16%, 25%, and 47% occur on slopes with gradients ranging
140 from 61° to 70°, from 71° to 80°, and from 81° to 90°, respectively. Figure 5 shows the tension

141 zones that developed at slope shoulders, where radial and tangential stresses transform into
142 tensile stresses. The steeper the slope is, the wider the tension band is (Stacey, 1970; Zhang et al.,
143 2009).

144 **Figure 4b** illustrates that slope height is another main factor **controlling** the occurrence of
145 cracking–sliding failures. In the study area, most cracking–sliding failures occur on slopes with
146 heights of 5 m to 40 m and thus account for 87% of the total number of occurrences. The
147 remaining 13% take place on slopes with heights of more than 40 m. A high slope normally
148 develops a gentle gradient because of long-term weathering and erosion. By contrast, a low slope
149 generally forms a steep gradient (Zhu et al., 2011), thereby becoming prone to collapses.

150 **Slopes mostly exposed to sunlight** are more prone to the development of cracking–sliding
151 failures than shady slopes (Fig. 4c). Statistical analysis shows that 69% of the cracking–sliding
152 failures occur on slopes with aspects in the range of 90° to 270°, particularly within 180° to 270°
153 because sunward slopes receive long sunshine hours and soil temperature is relatively high
154 during the day. Therefore, **high differences in** temperature **exist** between day and night. Sunward
155 slopes are generally subjected to more weathering than shady slopes, resulting in fractured
156 structures, which are **unfavorable** to slope stability. Furthermore, people usually reside on
157 sunward slopes, and dense human engineering activities exert a large degree of disturbance on
158 the slope body, thereby increasing the occurrence of failures.

159 **4.2 External factors**

160 **1) Rainfall**

161 Rainfall remarkably influences the stability of loess slopes. In **Figure 6**, the number of loess
162 failures is closely and positively correlated with the average monthly rainfall of the past 15 years.
163 Summer rainfall (July to September) in the study area accounts for approximately 60% of the
164 annual precipitation, and the number of cracking–sliding failures in the same period corresponds
165 to 62% of the total failures. This finding is consistent with that of Gao et al. (2012), who
166 indicated that more than 60% of loess failures happen in Gansu Province in the rainy season.
167 Wei (1995) and Liu et al. (2012) presented a similar conclusion in Shanxi and Shaanxi **provinces**,
168 respectively.

169 Rainfall induces loess cracking–sliding failures in three ways, namely, splash erosion, shovel
170 runoff, and seepage. At the beginning of rainfall, soil particles with poor adhesion are separated
171 and broken under the impact of raindrops. When potholes formed by splash erosion are filled
172 with water, a layer of water flow forms and triggers small soil particles to move. Along with the
173 continued rain, this water flow converges into the slope runoff to erode and destroy the slope
174 surface further (Tang et al., 2015). In cases of persistent rainfall, preferential seepage pipes

175 usually develop inside a slope, thereby saturating the soils, reducing the shear strength, and
176 eventually causing cracking–sliding failures.

177 **2) Freezing and thawing**

178 **Figure 6** shows that cracking–sliding failures occur frequently not only in the rainy season
179 from July to September but also in the winter-to-spring transition from March to April. Soil
180 temperature increases rapidly from **values** below 0°C to **values** above 0°C. As shown in **Figure 7**,
181 soil temperature remains negative, and the frozen depth can reach approximately 1.0 m
182 underground from late November to February in the loess areas in China. At the end of March,
183 the ground temperature begins to increase, and the frozen layer gradually enters the thawing
184 stage. By mid-April, the soil is rapidly heated up to approximately 8 °C.

185 Freezing and thawing mainly promote the occurrence of cracking–sliding failures via two
186 mechanisms: 1) Frost heaving damages the soil structure and reduces soil shear strength. The
187 loess itself contains a considerable number of large pores. Frost heaving further increases the
188 distance between soil particles, reduces the dry density of soil, and loosens the structure, thereby
189 reducing its cohesion and internal friction angle. 2) Thawing causes the loess structure to
190 collapse and reduce its shear strength. Thawed water can dissolve cement, especially calcareous
191 cement, between loess particles, consequently damaging the loess structure and increasing pore
192 water pressure; as a result, the shear strength of the soil decreases (Pang, 1986).

193 **3) Daily temperature fluctuation**

194 Consistent with previous findings (Wei, 1995), our results indicate a relatively high
195 frequency of occurrence of cracking–sliding failures between 10 pm and 4 am (Fig. 8). The
196 difference in temperature between day and night in the loess area is more obvious than that in
197 other regions at the same latitude in China (Sun and Zhang, 2011), and variations in air
198 temperature in a day can occasionally reach 30 °C. **The soil at a 50 cm depth shows an average**
199 **daily temperature difference of approximately 5 °C in summer (Fig. 9).** Thermal expansion and
200 shrinkage occur during the rapid change in day and night temperatures. Under the cyclic
201 functioning of shrinkage and expansion stresses, a soil structure loosens.

202 **4) Human activity**

203 Loess areas in China have a population of more than 200 million. **Human engineering**
204 **activities frequently occur and mainly involve cutting slopes for buildings, excavation for cave**
205 **dwelling, and construction of terraced fields and roads (Del Prete and Parise, 2013).** Cutting
206 slopes for buildings causes the side slope to become steep. Unloading-induced tensile fractures
207 are usually produced on the trailing edge of slopes during the rapid adjustment of a stress field
208 within a slope (Fig. 10a). When a cave is excavated, roof damage (normally caving) happens
209 because of a local tensile stress concentration if the design of a geometric section of a cave is

210 inappropriate (Fig. 10b). Terraced fields change the original path of surface runoff and enhance
211 rainfall infiltration. Together with irrigation, terraced fields increase the water content of loess
212 slopes and increase their phreatic level (Fig. 10c). The majority of traffic lines in the loess area
213 stretch along valleys and bank slopes. Slope cutting and excavation during road construction
214 result in a large number of high and steep side slopes, which provide a suitable environment for
215 failures (Fig. 10d).

216 More than half of the failures are attributed to human engineering activities (Fig. 11). In 2014,
217 9 of 16 failure cases that occurred in Yan'an City were caused by extremely steep slopes for cave
218 dwelling construction, and the 7 other cases were consequences of improper treatment of side
219 slopes for road construction (Lei, 2001). These findings demonstrate that intense human
220 activities likely result in a high probability of loess failures.

221 **5 Conclusions**

222 This study investigates the influencing factors and development patterns of loess cracking–
223 sliding failures in the **eastern** LPC according to a large collection of field investigation data. The
224 following conclusions are obtained.

225 (1) The influencing factors of cracking–sliding failures are divided into internal and
226 external causes. Internal causes include various features, such as slope geometry, height, gradient,
227 and aspect of loess slopes, whereas external causes comprise rainfall, freezing–thawing cycles,
228 temperature fluctuation, and human engineering activities.

229 (2) Cracking–sliding failure more likely occurs in rectilinear and convex slopes than in
230 concave and stepped slopes. Rectilinear and convex slope gradients are generally steep, stress
231 concentrations are obvious, and slope stability is poor. The stress concentration in concave and
232 stepped slopes is minimized, and stability is fair. Cracking–sliding failure more likely takes place
233 on slopes with gradients greater than 60° , and the greater the gradient is, the higher the likelihood
234 of failures. Cracking–sliding failure also tends to occur on slopes with heights of 5 to 40 m.
235 Slopes below 5 m have low internal stress and high stability. Slopes above 40 m are generally
236 gentle with low stress concentration. The dominant aspect of the development of cracking–
237 sliding failure is within 180° to 270° (sunward slopes) because of the evident temperature
238 difference between day and night and the strong weathering.

239 (3) The occurrence of cracking–sliding failure displays a particular time pattern. Within a
240 year, its occurrence coincides with seasonal rainfall. Failures mainly occur in the rainy season, or
241 from July to September. In addition, failures frequently take place from March to April because
242 of freezing and thawing. Within a day, failures happen mostly from 10 pm to 4 am because of the
243 large temperature variation between day and night.

244 (4) The more intense the engineering activities are, the greater the possibility of loess
245 failures is. Human engineering activities in loess areas include cutting slopes for buildings,
246 excavation of cave dwellings, and construction of terraced fields and roads. These engineering
247 activities usually lead to a rapid change in the features and stress field of slopes. Such high and
248 steep side slopes tend to develop unloading-induced tensile fractures, thereby increasing the
249 possibility of loess failures.

250 *Acknowledgments.* This study was supported by the Key Program of National Natural Science
251 Foundation of China (No. 41630640), the Major Program of the National Natural Science
252 Foundation of China (No. 41790445), the 2014 Fund Program for the Scientific Activities of
253 Selected Returned Overseas Professionals in Shanxi Province, Shanxi Scholarship Council of
254 China, Outstanding Innovative Teams of Higher Learning Institutions of Shanxi, Soft-science
255 Fund Project of Science and Technology in Shanxi, Research Project for Young Sanjin
256 Scholarship of Shanxi, Collaborative Innovation Center for Geohazard Process and Prevention at
257 Taiyuan Univ. of Tech., Recruitment Program for Young Professionals of China.

258 **References**

259 Cruden, D. M., and Varnes, D. J.: Landslide types and processes, In: Landslides: investigation
260 and mitigation, Transportation Research Board Special Report., 247, 1996.

261 Del, Prete, S., Parise, M.: An overview of the geological and morphological constraints in the
262 excavation of artificial cavities, In: Filippi, M., Bosak, P. (Editors), Proceedings 16th
263 International Congress of Speleology, Brno, 21-28 July 2013, vol. 2, p. 236-241.

264 Gao, H., Zhang, Y. J., and Zhang, X. G.: Factors on geological hazards of loess slope in Lanzhou
265 city, Gansu Geol., 3, 30-36, 2012.

266 Huang, Z., Xu, M., Wang, L., Mi, N., Yu, D., and Li, H.: Shear wave splitting in the southern
267 margin of the Ordos Block north China, Geophys. Res. Lett., 35, 402-411, 2008.

268 Hui, X., Research on relationship between geo-hazard and rainfall in Loess Plateau of Northern
269 Shanxi Province, Ph.D. thesis, Chang'an University, Xi'an, China, 2010.

270 Lei, X. Y.: Geohazards of Loess Plateau and their relation with human activities, Geol. Press.,
271 2001.

272 Liu, J., Zhang, P., Lease, R.O., Zheng, D., Wan, J., Wang, W., and Zhang, H.: Eocene onset and
273 late Miocene acceleration of Cenozoic intracontinental extension in the North Qinling range-
274 Weihe graben: Insights from apatite fission track thermochronology, Tectonophysics, 584,
275 281-296, 2012.

276 Liu, J. N., Gu, Y., Jin, J., Ni, S. H., and Shen, Y.: Analysis of rainfall, floods and droughts in
277 middle Shanxi in recent years, China, J. China. Hydrol., 2, 51-54, 2013.

278 Lv, M.: The present situation of the loess collapse of geological disasters in Shanxi Province and
279 the water sensitivity analysis, Ph.D. thesis, Taiyuan University of Technology, Taiyuan,
280 China, 2011.

281 Pang, G. L.: A discussion on maximum seasonal frost depth of ground, China, *J. Glaciol.*
282 *Geocryol*, 3, 253-254, 1986.

283 **Pye, K.: Aeolian dust and dust deposits. Academic Press, London, 1987.**

284 Qian, P.: Study of types for highway drainage system in loess areas in northern Shaanxi Province,
285 Ph.D. thesis, Chang'an University, Xi'an, China, 2011.

286 Qin, L. L., Qi, Q., and Ju, Y. W.: Study on the feature governance research of loess geological
287 disasters in Shanxi Province, China, *Shanxi Archit.*, 6, 58-59, 2015.

288 Qu, Y. X., Zhang, Y. S., and Chen, Q. L.: Preliminary study on loess slumping in the area
289 between northern Shaanxi and western Shanxi – taking the pipeline for transporting gas from
290 west to east in China, China, *J. Eng. Geol.*, 9, 233-240, 2001.

291 **Richthofen, F.von.: On the mode of origin of the Loess. *Geol. Mag.* 9, 293-305, 1882.**

292 Smalley, I., Marković, S. B., and Svirčev, Z.: Loess is [almost totally formed by] the
293 accumulation of dust, *Quaternary International*, 240, 4-11, 2011.

294 Stacey, T. R.: The stress surrounding open-pit mine slope, In: *Planning Open Pit Mine*, 1970.

295 Sun, Z. X., and Zhang, Q.: Analysis of climate characteristics of land surface temperature and
296 energy in the semi-arid region in the Loess Plateau, China, *J. desert Res*, 5, 1302-1308, 2011.

297 Tang, Y. M., Feng, W., and Li, Z. G.: A review of the study of loess slump, China, *Adv. Earth*
298 *Sci.*, 1, 26-36, 2015.

299 Wei, Q. K.: Collapse hazards and its distribution features of time and space in Shaanxi Province,
300 China, *J. Catastrophol.*, 10, 55-59, 1995.

301 Xin, C. L., Yang, G. L., Zhao, Z. P., Sun, X. H., Ma, W. Y., and Li, H. R.: Characteristics,
302 causes and controlling of loess collapses in Beishan mountain of Tianshui city, China, *Bull.*
303 *Soil Water Conserv.*, 33, 120-123, 2013.

304 Yang, W. Z., and Shao, M. A.: Researches of soil moisture in Loess Plateau, *Sci. Press.*, 1995.

305 Zhang, Z.H.: The compilation principle of landscape type map of Chinese Loess Plateau, China,
306 *Hydrogeology and Engineering Geology*, 2, 29-33, 1983.

307 Zhang, Z.H.: Institute of hydrogeology and engineering geology of Chinese Academy of
308 Geological Sciences, China, *Landscape type Map and Instructions of Chinese Loess Plateau*
309 (1:500000), Beijing, Geological Press., 1986.

310 Zhang, Z. Y., Wang S. T., Wang L. S., Huang R. Q., Xu Q., and Tao L. J.: Engineering
311 geological analysis principle, *Geol. Press.*, 2009.

312 Zhang, H.: Study of water migration and strength of the loess under freezing-thawing action,
313 Ph.D. thesis, Xi'an University of Architecture and Technology, Xi'an, China, 2014.

- 314 Zhu, J. H.: Study on the relationship between slope geometrical morphology and landslide
315 collapse disasters in Yan'an, Ph.D. thesis, Chang'an University, Xi'an, China, 2014
- 316 Zhu, Y. C., Li, J., and Ren, Z. Y.: Change tendency and relevant analysis about cultivated land
317 and population in Loess Plateau during about 300 years, China, J. Shaanxi Norm. University
318 (Natur. Sci. Ed.), 3, 84-89, 2011.

Captions of figures and tables

Table 1. Classification of loess slopes.

Figure 1. The cracking-sliding failure occurred in Shilou County of Shanxi Province on March 10, 2018 (110°50'48.54"E, 36°59'54.76"N).

Figure 2. Geological map of the study area. The red dots denote the cracking–sliding failure cases, and the blue dots indicate the meteorological stations in the study area.

Figure 3. Statistical analysis results: a) classification of loess slopes in Lishi City, Shanxi Province, China, on the basis of a field survey of 212 loess slopes, indicating that stepped slopes are dominant in the study area. b) Percentage of cracking–sliding failures that occurred in different types of loess slopes across the study area, showing that rectilinear slopes are highly susceptible to loess failures.

Figure 4. Effect of slope features on cracking–sliding failures.

Figure 5. Development of tension zones in slopes of different gradients (Stacey, 1970; Zhang et al., 2009).

Figure 6. Occurrence of cracking–sliding failures mainly in July to September and consistent with the average monthly rainfall.

Figure 7. Annual variation of temperature (°C) within a shallow zone of a typical loess slope (Yang and Shao, 1995).

Figure 8. Temporal distribution of cracking–sliding failures in a day between 10 pm and 4 am.

Figure 9. Daily soil temperature variation in loess areas of China in summer. Data are from the field monitoring during April 2014 to September 2017 in Linxian County, Shanxi, China.

Figure 10. Typical engineering activities in loess areas in China: a) cut slopes for buildings; b) excavations for cave dwellings; c) terraced fields for farming; and d) cut slopes for highways.

Figure 11. Role of engineering activities in loess failures: a) Shanxi Province; and b) Huangling County, Shaanxi Province.

Table 1. Classification of loess slopes.

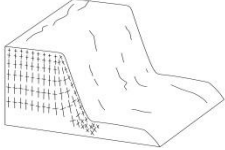
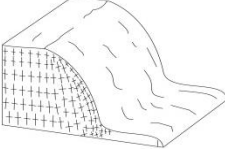

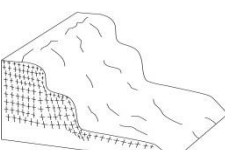
Slope type	Profile	Characteristics	Susceptibility to cracking–sliding failure
Rectilinear		Slope is straight or nearly straight; slope gradients are fairly large (>55°); stability is low.	Yes
Convex		Gentle at the top and steep at the bottom; convex shoulder; stability is generally poor.	Yes
Concave		Curves inward; gentle toward the toe supporting steep upper slope; more stable than other slopes; stability is fair.	No
Stepped		Stepped with straight faces; average gradient of the overall slope is generally small; stability is good.	No



Figure 1. The cracking-sliding failure occurred in Shilou County of Shanxi Province on March 10, 2018 ($110^{\circ}50'48.54''\text{E}$, $36^{\circ}59'54.76''\text{N}$).

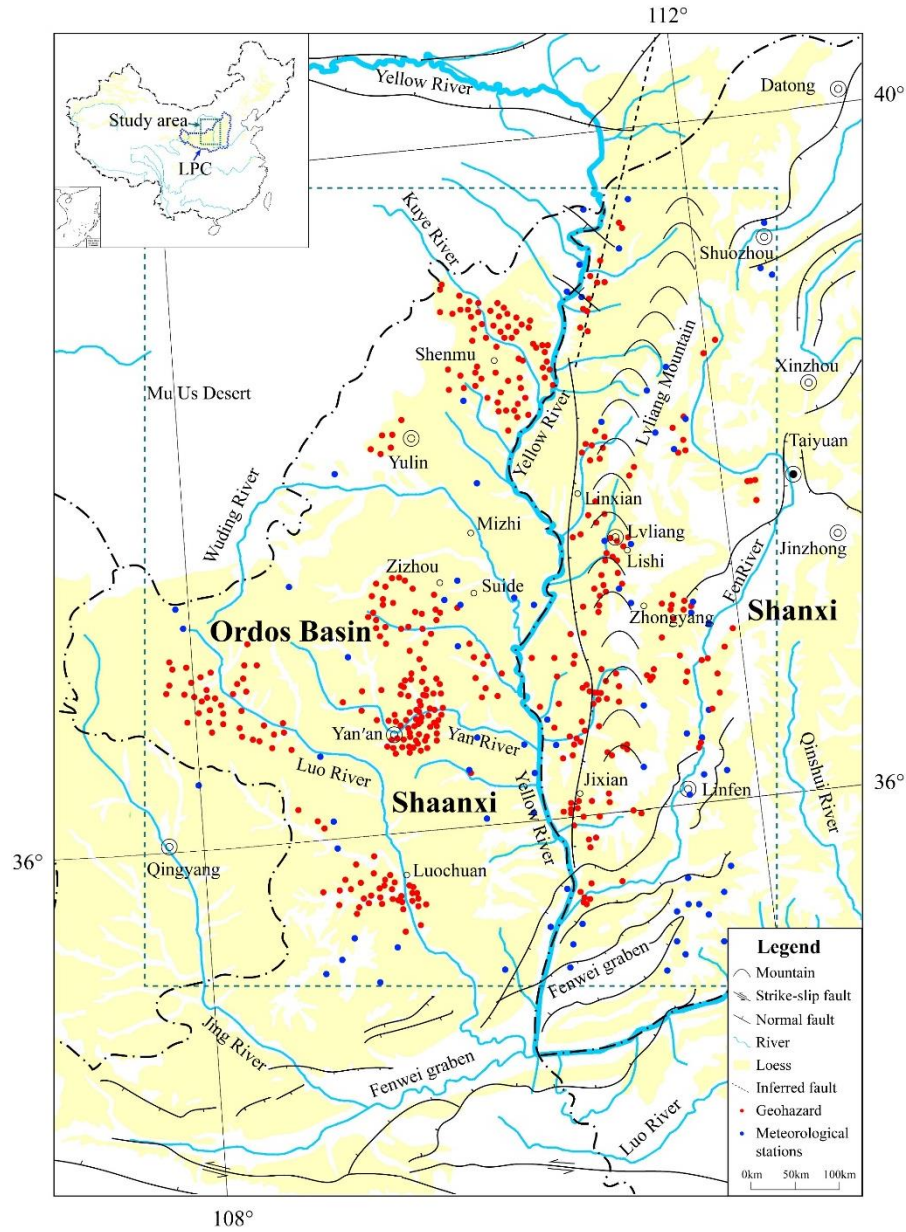


Figure 2. Geological map of the study area. The red dots denote the cracking–sliding failure cases, and the blue dots indicate the meteorological stations in the study area.

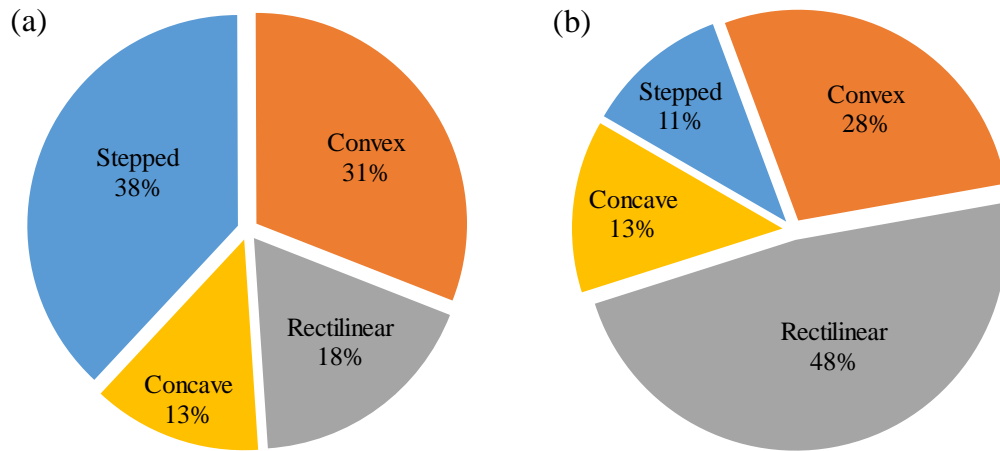


Figure 3. Statistical analysis results: a) classification of loess slopes in Lishi City, Shanxi Province, China, on the basis of a field survey of 212 loess slopes, indicating that stepped slopes are dominant in the study area. b) Percentage of cracking-sliding failures that occurred in different types of loess slopes across the study area, showing that rectilinear slopes are highly susceptible to loess failures.

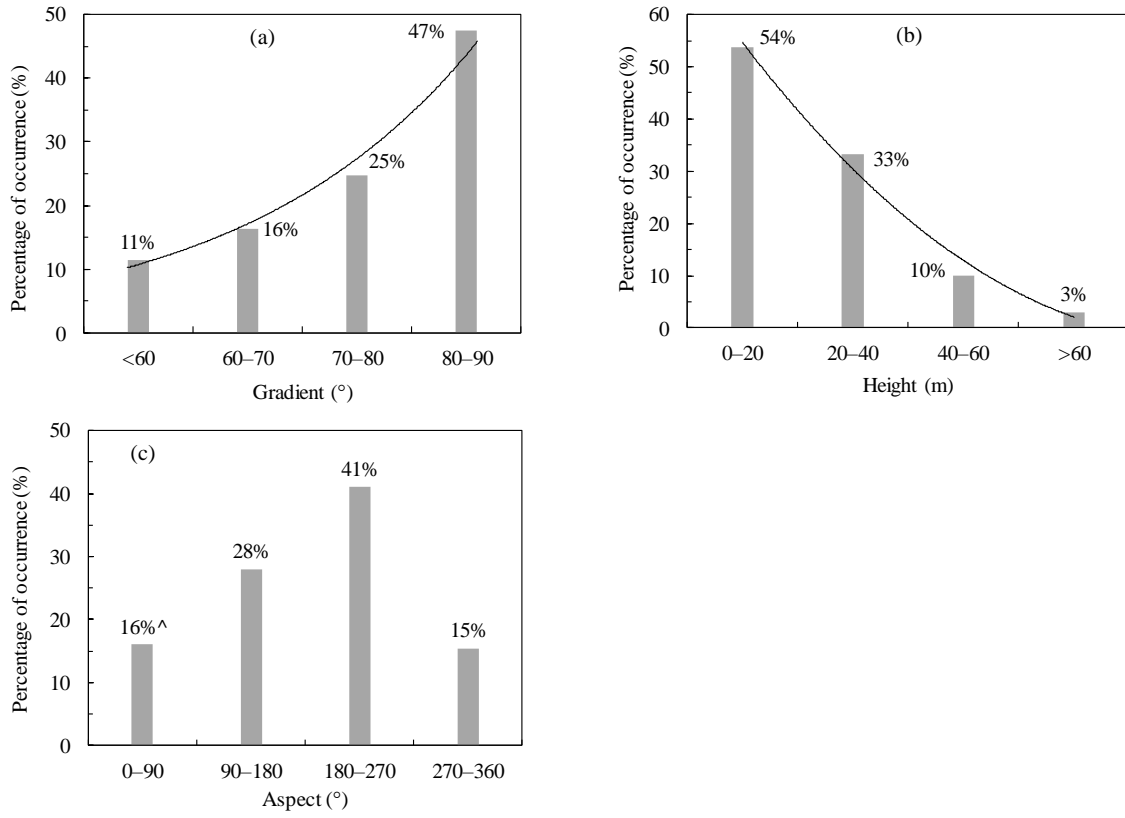


Figure 4. Effect of slope features on cracking-sliding failures.

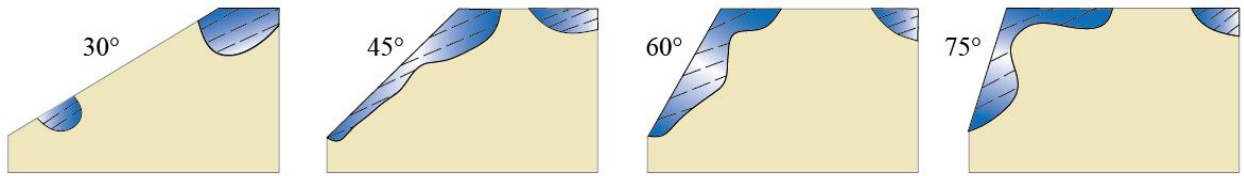


Figure 5. Development of tension zones in slopes of different gradients (Stacey, 1970; Zhang et al., 2009).

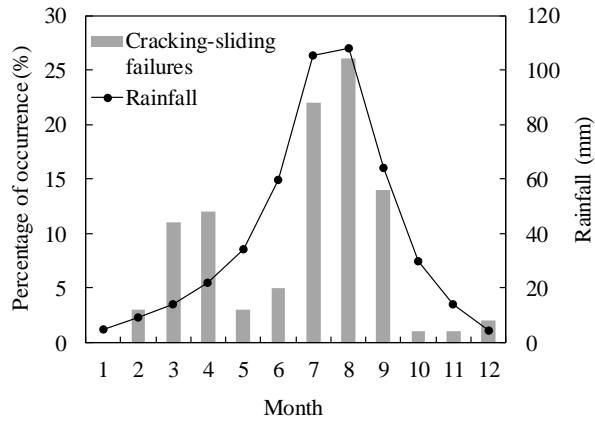


Figure 6. Occurrence of cracking–sliding failures mainly in July to September and consistent with the average monthly rainfall.

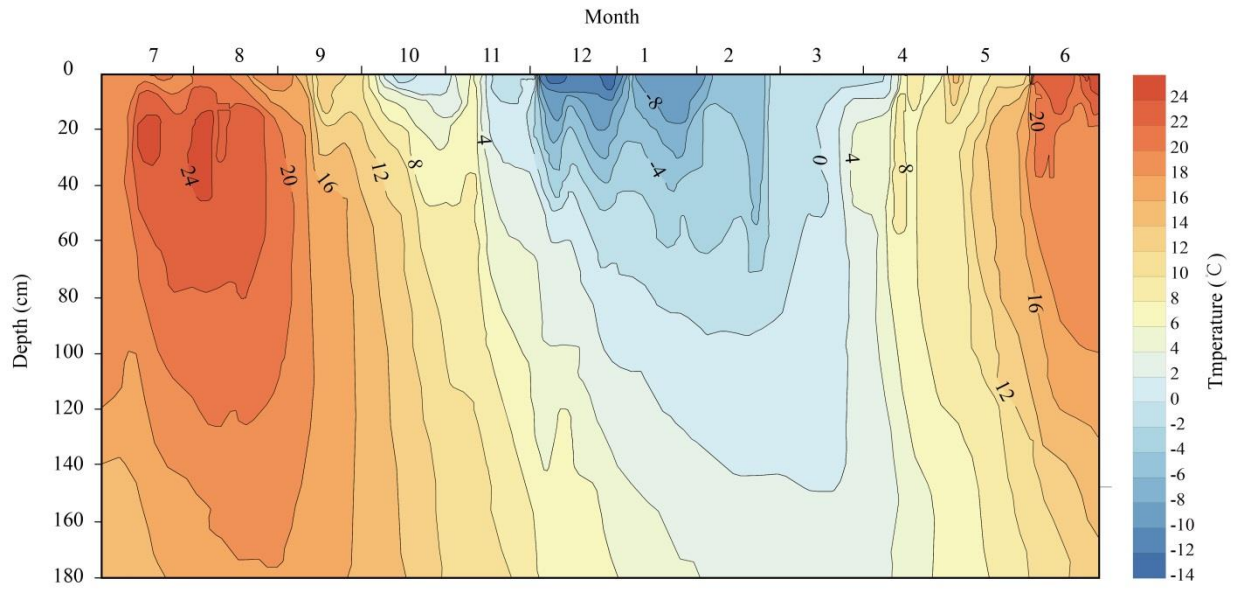


Figure 7. Annual variation of temperature ($^{\circ}\text{C}$) within a shallow zone of a typical loess slope (Yang and Shao, 1995).

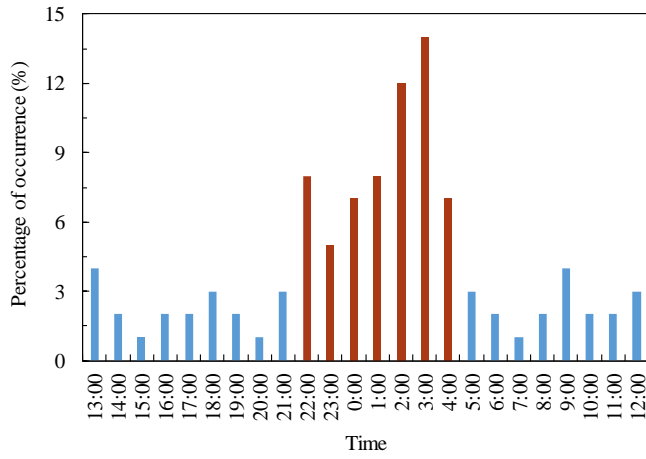


Figure 8. Temporal distribution of cracking–sliding failures in a day between 10 pm and 4 am.

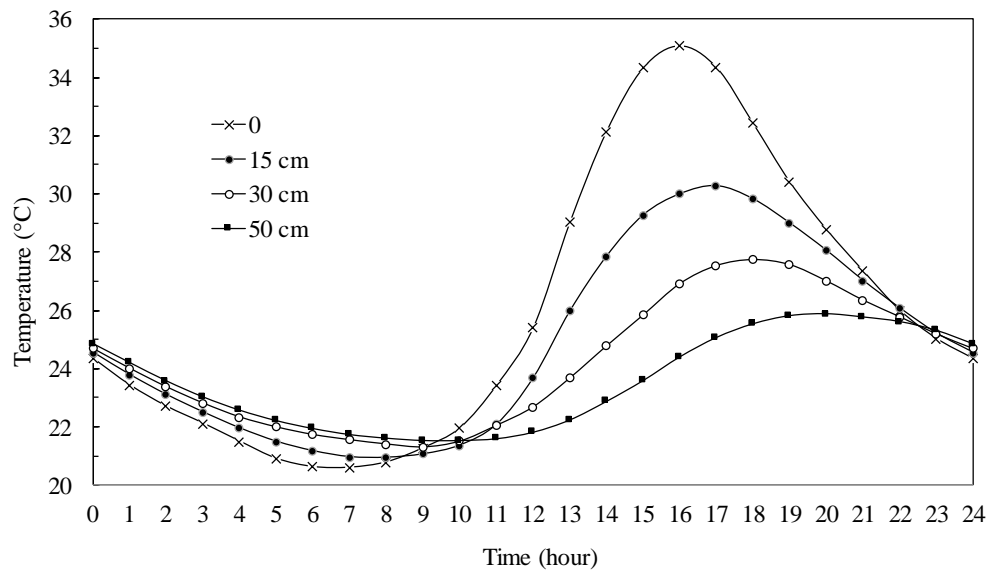


Figure 9. Daily soil temperature variation in loess areas of China in summer. Data are from the field monitoring during April 2014 to September 2017 in Linxian County, Shanxi, China.

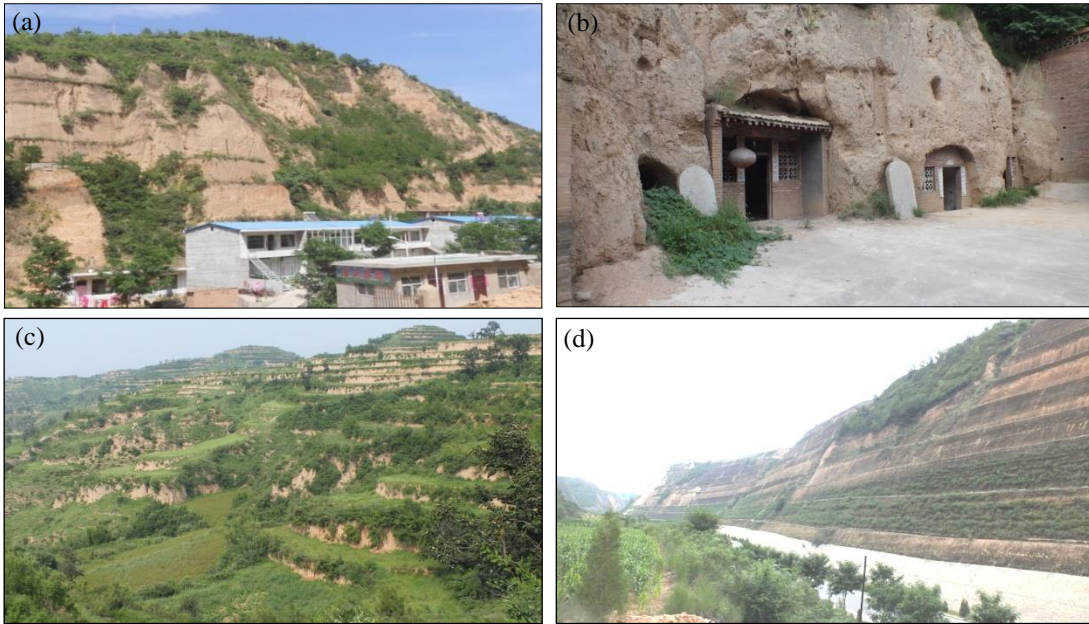


Figure 10. Typical engineering activities in loess areas in China: a) cut slopes for buildings; b) excavations for cave dwellings; c) terraced fields for farming; and d) cut slopes for highways.

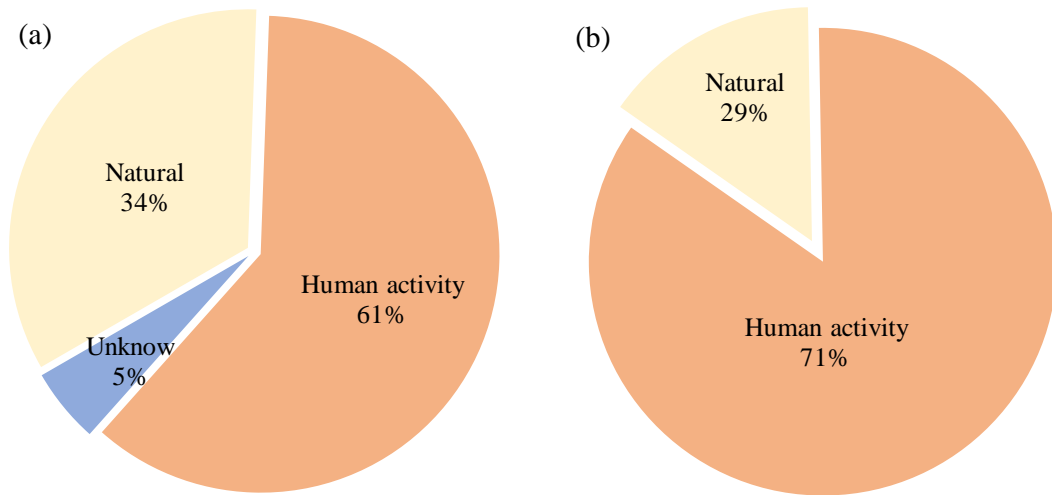


Figure 11. Role of engineering activities in loess failures: a) Shanxi Province; and b) Huangling County, Shaanxi Province.