



**Survey of the 2013
Super Typhoon
Haiyan**

E. Mas et al.

This discussion paper is/has been under review for the journal Natural Hazards and Earth System Sciences (NHESS). Please refer to the corresponding final paper in NHESS if available.

Field survey report and satellite image interpretation of the 2013 Super Typhoon Haiyan in the Philippines

E. Mas, J. Bricker, S. Kure, B. Adriano, C. Yi, A. Suppasri, and S. Koshimura

International Research Institute of Disaster Science (IRIDeS), Tohoku University, Japan

Received: 16 April 2014 – Accepted: 9 May 2014 – Published: 27 May 2014

Correspondence to: E. Mas (mas@irides.tohoku.ac.jp)

Published by Copernicus Publications on behalf of the European Geosciences Union.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



Abstract

Three weeks after the deadly Bohol earthquake of magnitude M_w 7.2, which claimed at least 222 victims; another disaster struck the Philippines. This time, Super Typhoon Haiyan, also known as Typhoon Yolanda in the Philippines, devastated the Eastern Visayas islands on 8 November 2013. Its classification as a Super Typhoon was based on its maximum sustained 1 min surface wind speed of 315 km h^{-1} , which is equivalent to a strong Category 5 hurricane on the Saffir–Simpson Scale. This was one of the deadliest typhoon events in the Philippines' history, after the 1897 and 1912 tropical cyclones. At least 6268 individuals have been reported dead and 1061 people are missing. In addition, a wide area of destruction was observed in the Eastern Visayas, on Samar and Leyte Islands. The International Research Institute of Disaster Science (IRIDeS) at Tohoku University in Sendai, Japan has deployed several teams for damage recognition, relief support and collaboration with regard to this disaster event. One of the teams, the hazard and damage evaluation team, visited the affected areas in the Eastern Visayas in mid-January 2014. In this paper, we summarize the rapid damage assessment conducted days after the event and report on the inundation measurements and the damage surveyed in the field. Damage interpretation results by satellite images were qualitatively confirmed for the Tacloban city area on Leyte Island, the most populated city in the Eastern Visayas. During the survey, significant damage was observed from wind and storm surges on poorly designed housing on the east coast of Leyte Island. Damage, mainly from surface waves and winds was observed on the east coast of Samar Island.

1 Introduction

Typhoons are tropical cyclone systems with high-intensity of wind speeds. According to the intensity scale used by the Japan Meteorological Agency (JMA), a tropical cyclone is designated as a typhoon when the sustained wind speed exceeds the 118 km h^{-1} ,

NHESSD

2, 3741–3767, 2014

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures

⏪

⏩

◀

▶

Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



west-northwest across the Eastern Visayas (Fig. 1). The second landfall occurred over Tolosa in the Leyte Island at 07:00 LT. According to survivors interviewed at Tacloban, north of Tolosa, 07:00 is also the time when the surge began to inundate and washed away houses on the coast near the city. A third landfall happened over Daanbantayan in Cebu at approximately 09:40. By the end of the day and into the next afternoon, the typhoon weakened towards the West Philippine Sea, and, finally, it was reported to be outside the PAR. Details of the event can be seen online in survivor videos, in particular those from cyclone hunters such as the iCyclone group (Morgerman et al., 2014). Here, we quote some of Morgerman et al. (2014)'s observations of the event experienced by his team in the Tacloban city downtown area, *"Haiyan was a small, fast-moving, extremely violent cyclone that made a direct hit on Tacloban City"*. According to this chase report Haiyan presented destructive winds starting at 6:45, with the highest winds and heaviest rain occurring at approximately 7:25. Their estimations suggest a storm surge of 20 to 30 ft (6 to 9 m), observed as a sudden rise of the sea at 7:30, which reached its highest peak between approximately 8:00 and 8:15 with lightning and thunder occurring during this interval. A storm surge inundation and destructive winds were observed from 6:45 to 8:45, a short-duration event compared with other tropical cyclones. Nevertheless, Typhoon Haiyan was one of the strongest and deadliest typhoons in the Philippine history. As of 14 March 2014, 6268 fatalities have been reported, 28 689 persons have been injured and 1061 are still missing due to the typhoon's aftermath (NDRRMC, 2014; Tajima et al., 2014; Mas et al., 2014).

3 Damage interpretation from satellite images

After disasters with wide areas of impact, information related to the extent of damage and the areas in need of assistance and relief is often limited. Satellite imagery can provide disaster information, including the extent and level of damage in areas with limited accessibility, used to support emergency response (Wegscheider et al., 2013). Such efforts have been conducted after earthquakes, tsunamis and hurricanes (e.g

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



Hurricane Katrina and the East Japan Earthquake, Tsunami and Nuclear Accident) (Ramírez-Herrera and Navarrete-Pacheco, 2012; Gokon and Koshimura, 2012). This paper describes IRIDeS' initial efforts using satellite imagery to map the damage in the Tacloban area from Super Typhoon Haiyan. The damage assessment approach used for this event was the manual visual interpretation method. Visual interpretation is one of the most straightforward methods to assess damage in a wide area, and it is the most accurate (Koshimura et al., 2009; Suppasri et al., 2011; Mas et al., 2012; Wegscheider et al., 2013) when using very-high-resolution imagery. Some limitations to this method are its use of subjective interpretation, which can vary from user to user; that the availability of satellite images of the impacted area depends on weather conditions; and that it is time consuming.

3.1 Data description

This study uses pre- and post-event satellite images to identify damage to building roofs. Pre-event satellite imagery of Tacloban city was readily accessible through Google Earth, while post-event remote sensing data of the damaged area was obtained on 13 November 2013 through Digital Globe in Google Earth and through CNES Pleiades/Astrium imagery from the ArcGIS Map Service. The two images are shown in Fig. 2.

3.2 Damage visual inspection and mapping

A visual comparison of the pre- and post-event images was conducted with a house-by-house assessment of the damage due to Super Typhoon Haiyan. A house or structured was considered damaged if it had a partially or entirely damaged roof or, in extreme cases, if it had been washed or blown away. The damage assessment was classified into only two categories to accelerate interpretation, as rapid assessment of the event was necessary. The categories are:

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



– High damage or destruction. For this classification, the interpretation focused on the roofs that had been reduced by more than 50 % between pre- and post-event images. In addition, when the structure had been washed or blown away, it was defined as destroyed.

– Low damage or survival. For this classification, the visual interpretation focused on the structures with only small variations in geometry or roof shape. In addition, when there was no visual variation but the structure was near an expected flooded area, the level was classified as low damage or survival.

The results of this assessment are shown in Fig. 3. Significant damage was interpreted in the coasts to the north and south of downtown Tacloban. During our field survey, we visually confirmed the extensive damage in these areas. The verification of our interpretation is, at this moment, qualitative due to the difficulties experienced during the field survey in gathering detailed information at a house-by-house resolution (Fig. 4). The extensive damage interpreted to the north and south of the downtown was confirmed to be due to the high vulnerability of the structures in these areas and to the presence of stranded ships, which caused most of the damage near the Anibong area (Fig. 5).

4 Field survey of the Super Typhoon Haiyan affected areas**4.1 Dispatch of IRIDeS survey team**

In mid-January, the IRIDeS of Tohoku University deployed a second group to coordinate field survey efforts in the affected areas in the Eastern Visayas. The field survey team inspected the affected areas to determine the extent of inundation extent and to comprehend the mechanisms of the structural and building damage through inspection and measurement of inundation heights. Observations and measurements of the storm surge inundation and the ongoing recovery of Tacloban and the surrounding affected

areas are reported in this paper. The team was dispatched on 14 January 2014, and they surveyed the areas shown in Fig. 6.

4.2 Objectives of the survey

1. Gather the available data to verify the rapid damage assessment conducted using satellite image analysis, as explained in the previous section.
2. Measure inundation heights from storm surges and surface waves to verify the numerical models-the outputs of the numerical simulation are presented in Bricker et al. (2014).
3. Establish a collaborative partnership to evaluate the impacts on the mental health of the people affected by the disaster.

4.3 Overview of the survey

The team was divided at Tacloban city into two groups, the hazard and damage evaluation group and the disaster medicine group. The first group focused on the first two objectives of the mission, while the second group was in charge of the third objective. Local counterparts joined both groups for support and for future collaboration. The locations of the storm surge and wave inundation measurements in the visited areas are shown in Fig. 7. These measurements were conducted using portable laser rangefinders referenced to the sea level at the time of the survey. A supplement related to this article with the table of measurements is available online. Extensive damage to buildings from wind and surges was observed in the Tacloban city coastal area. In particular, houses made of rafters with corrugated galvanized iron (CGI) sheets on the roof were blown or washed away. Storm surge heights of up to 6 m were measured near the shoreline. Moreover, survivors reported waves over the surge, which could have been nearly 4 m high. Damage was also observed from ships carried by waves to inland areas. In downtown Tacloban, buildings are made of masonry or reinforced

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



**Survey of the 2013
Super Typhoon
Haiyan**

E. Mas et al.

Title Page	
Abstract	Introduction
Conclusions	References
Tables	Figures
◀	▶
◀	▶
Back	Close
Full Screen / Esc	
Printer-friendly Version	
Interactive Discussion	

concrete and suffered slight damage from wind and first floor inundation, however, significant structural damage was not observed to most of the buildings. In contrast, areas to the north-west and south-east of downtown Tacloban were highly impacted due to the lightweight materials used for construction and the non-engineered characteristics of the houses. Conversely, the Daniel Z. Romualdez (DZR) Airport at Tacloban was heavily damaged by winds of 300 km h^{-1} and surges from 4 to 6 m in height. The airport was reopened for humanitarian aid three days after the disaster, and, by the time of our field survey, it had reopened for domestic flights. Survivors were interviewed during the field survey, and they reported having resisted the surge by clinging to palm trees or staying on rooftops. Most of the local residents did not evacuate rapidly because they overlooked storm warnings as their previous experiences had not been as critical as Typhoon Haiyan. In addition, to protect their assets and belongings, some of them stayed at home instead of looking for high ground or refuge.

4.4 Damage observed in Leyte Island

The Leyte Island is in the Visayas group of islands in the Philippines. It is located in the Eastern Visayas, and its capital city is Tacloban on the eastern shore at the northwest of Leyte Gulf. The City of Tacloban has suffered previous destruction and loss of life during the typhoon of 1897 and the 1912 tropical storms. This time, Super Typhoon Haiyan struck the city of more than two hundred thousand inhabitants causing massive destruction and death. The storm surge was measured to be between 4 and 6 m in the downtown area, 6 m to the south and up to 8 m to the north of downtown Tacloban, in the Anibong area. Damage due to wind was present throughout the survey area. The major mechanism of wind damage was the ripping of the roofing materials off the frames of structures. The most common roofing material is CGI sheets, which are popular because of their low cost and ease of installation. They are attached to the roofing frame/rafters (usually wooden, though sometimes metal) by nails. A common mechanism of failure is the nails ripping through the CGI sheet. Sometimes the sheets and the nails are different metals, which can accelerate corrosion of both the nail and



waves on top of the surge. The complete collapse of lightweight-material houses was observed. Residents have reconstructed temporary private refuges with debris from the disaster.

4.4.4 Anibong area

The Anibong area is located immediately to the north of downtown Tacloban, in the coastal area of the Panalaron bay. The Anibong and neighboring barangays (villages) were intensely damaged by the storm surge, the winds and the waves. Ships stranded here were the main cause of damage in the area (Fig. 5). Behind Anibong, a steep hill functioned as a barrier to the surge; however, the hill remains unstable due to the erosion of its slopes. Figure 11 shows the damage to frame concrete structures; a local landslide and soil erosion were deep enough to uncover house foundations and tree roots. Pile dwellings, or palafittes, are the main type of house found in this area. Due to these houses' lightweight building materials and their wooden piles not being deep enough in the sandy soil, this was one of the most vulnerable places in the Tacloban city area.

4.4.5 Northern areas of Leyte Island

Driving north from Tacloban city, Leyte Island is connected to Samar Island by the San Juanico Bridge. We surveyed the area and found flooding heights up to 5.9 m with damage to equipment and furniture inside concrete structures. No significant structural damage was reported in these areas. Farther to the north, along the San Juanico strait, villages such as Old Kauayan and Tagpuro were affected by surge inundations between 4 m and 6 m high and by a measured runup on the hill of Tagpuro of 6.9 m in height. In Old Kauayan, there was extensive damage to coastal wooden houses and to the community school. A seawall of 3 m was overtopped, and the flow generated scour at the wall's landward side. The northern part of the area visited by the team was Barangay Rosal, where the local mayor described the event and reported heights up

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



to 5 m. Significant damage was observed to pile dwellings located behind a 3 m-high seawall, which was overtopped by the storm surge, and roofs were ripped off by the winds. The storm surge mainly affected the west side of the San Juanico strait, from the bridge up to the north (Fig. 12).

4.5 Damage observed in Samar Island

Little damage from the storm surge was observed on the northern side of the San Juanico strait on West Samar Island. The team visited three locations here, and only one small village next to the San Juanico Bridge presented houses affected by the surge. However, wind did rip off many lightweight roofs in the villages of West Samar Island. Most of these houses were already reconstructed using the same corrugated galvanized iron blown off by the wind. Most of the damage at Samar Island was observed on the east coast, facing the Pacific Ocean. Here, debris and witness accounts indicate inundation and runup to 11 m a.s.l. (Fig. 13). Many coastal, concrete-based structures were entirely destroyed, with concrete blocks from walls and foundations deposited up to 30 m inland by the wave force. The coral-filled seawall in Hernani was breached in multiple locations, and substantial scour existed on the beach. Coral boulders were found on the beach at an elevation of 5 m a.s.l., possibly transported there by Haiyans waves (Fig. 14). Most witnesses reported a typical wave attack, with water approaching and then retreating over a period of 10–20 s. However, in one low-lying area in Hernani-recorded on video by a member of the NGO Plan Philippines-the wave runup approached for over 1 min before receding. Another low-lying area south of Guiuan, located approximately 1 km from the coast, reported long-duration flooding as waves ran overland to the area. In both cases, a localized dip in topography prevented the water from receding quickly.

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



5 Conclusions

This paper reports on two response activities conducted by IRIDeS after the impact of Super Typhoon Haiyan in the Philippines. First, a rapid damage assessment was conducted through satellite visual images, and then, the damage was confirmed qualitatively through field survey observations. The results of the interpretation and the findings of the field survey observations were presented in this paper. Based on our field survey data, Super Typhoon Haiyan affected the Eastern Visayas with storm surge heights from 4 m to 8 m at Leyte Island, with an average inundation height of approximately 6 m. Moreover, surface waves were predominant on the east side of Samar Island, with a maximum height of 11 m observed at Guiuan. More significant damage was observed in the coastal areas to the north and south of Tacloban city compared to the downtown area. Several ships were taken inland by the surge, causing damage to houses in the Anibong area. Details of the survey point data are appended to this publication.

The Supplement related to this article is available online at doi:10.5194/nhessd-2-3741-2014-supplement.

Acknowledgements. We thank our counterparts in the Philippines for their support before and during the field survey. This field survey was sponsored by the International Research Institute of Disaster Science (IRIDeS) and the Discretionary Budget of Tohoku University's president.

References

- Bricker, J., Takagi, H., Mas, E., Kure, S., Adriano, B., Yi, C., and Roeber, V.: Spatial variation of damage due to storm surge and waves during Typhoon Haiyan in the Philippines, *Journal of Japan Society of Civil Engineers, Ser. B2 (Coastal Engineering)*, Vol. 70, No. 2. (Abstract accepted), 2014. 3747
- Daniell, J., Mühr, B., Girard, T., Dittrich, A., Fohringer, J., Lucas, C., and Kunz-Plapp, T.: Super Typhoon Haiyan/Yolanda – Report No. 2, Tech. Rep. 2, CEDIM FDA, 2013. 3743

NHESSD

2, 3741–3767, 2014

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page	
Abstract	Introduction
Conclusions	References
Tables	Figures
◀	▶
◀	▶
Back	Close
Full Screen / Esc	
Printer-friendly Version	
Interactive Discussion	

Gokon, H. and Koshimura, S.: Mapping of building damage of the 2011 Tohoku earthquake tsunami in Miyagi prefecture, *Coast. Eng. J.*, 54, 1250006-1, doi:10.1142/S0578563412500064, 2012. 3745

Koshimura, S., Oie, T., Yanagisawa, H., and Imamura, F.: Developing fragility functions for tsunami damage estimation using numerical model and post-tsunami data from Banda Aceh, Indonesia, *Coast. Eng. J.*, 51, 243–273, doi:10.1142/S0578563409002004, 2009. 3745

Mas, E., Koshimura, S., Suppasri, A., Matsuoka, M., Matsuyama, M., Yoshii, T., Jimenez, C., Yamazaki, F., and Imamura, F.: Developing Tsunami fragility curves using remote sensing and survey data of the 2010 Chilean Tsunami in Dichato, *Nat. Hazards Earth Syst. Sci.*, 12, 2689–2697, doi:10.5194/nhess-12-2689-2012, 2012. 3745

Mas, E., Kure, S., Bricker, J., Adriano, B., Yi, C., Suppasri, A., and Koshimura, S., Field survey and damage inspection after the 2013 Typhoon Haiyan in The Philippines, *Journal of Japan Society of Civil Engineers, Ser. B2 (Coastal Engineering)*, Vol. 70, No. 2. (Abstract accepted), 2014. 3744

Morgerman, J., Reynolds, J., and Thomas, M.: iCyclone Chase Report – Final, Tech. rep., iCyclone, available at: http://www.icyclone.com/upload/now/feb2014/iCyclone_Chase_Report_HAIYAN2013_FINAL.pdf, 2014. 3744

NDRRMC: SitRep No 107 Effects of Typhoon “YOLANDA” (HAIYAN), Tech. rep., National Disaster Risk Reduction and Management Council (NDRRMC), 2014. 3743, 3744

Ramírez-Herrera, M. T. and Navarrete-Pacheco, J. A.: Satellite data for a rapid assessment of tsunami inundation areas after the 2011 Tohoku Tsunami, *Pure Appl. Geophys.*, 170, 1067–1080, doi:10.1007/s00024-012-0537-x, 2012. 3745

Suppasri, A., Koshimura, S., and Imamura, F.: Developing tsunami fragility curves based on the satellite remote sensing and the numerical modeling of the 2004 Indian Ocean tsunami in Thailand, *Nat. Hazards Earth Syst. Sci.*, 11, 173–189, doi:10.5194/nhess-11-173-2011, 2011. 3745

Tajima, Y., Yasuda, T., Pacheco, B. M., Cruz, E. C., Kawasaki, K., Nobuoka, H., Miyamoto, M., Asano, Y., Arikawa, T., Ortigas, N., Aquino, R., Mata, W., Valdez, J., Briones, F.: Initial report of JSCE-PICE joint survey on the storm surge disaster caused by Typhoon Haiyan, *Coast. Eng. J.*, 56, 1450006, doi:10.1142/S0578563414500065, 2014. 3744

Wegscheider, S., Schneiderhan, T., Mager, A., Zwenzner, H., Post, J., and Strunz, G.: Rapid mapping in support of emergency response after earthquake events, *Nat. Hazards*, 68, 181–195, doi:10.1007/s11069-013-0589-y, 2013. 3744, 3745



Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

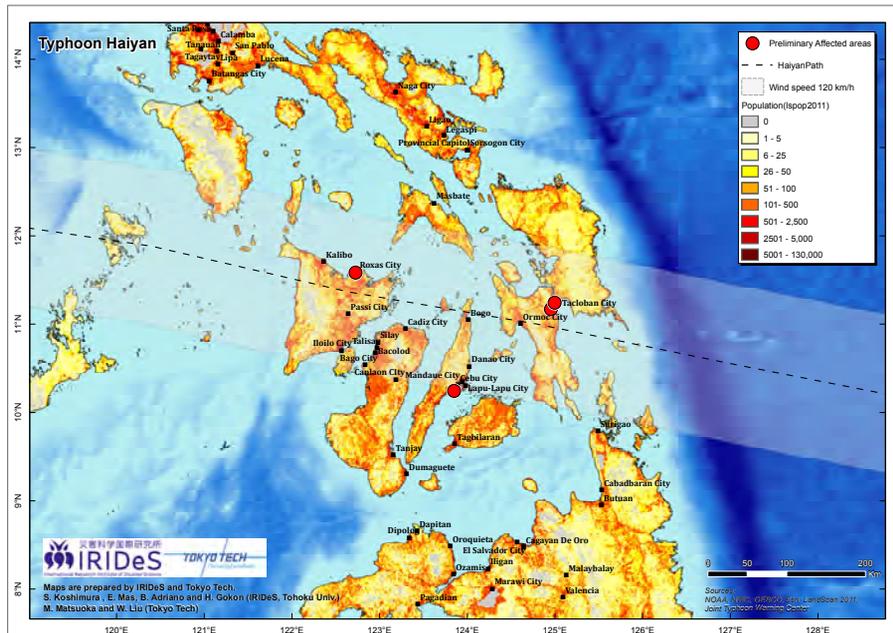


Figure 1. Track of the Super Typhoon Haiyan through the Philippines Area of Responsibility (PAR) overlaid on the LandScan population data. Almost 4 million families were affected across 44 provinces of the Eastern Visayas.

Discussion Paper | Discussion Paper | Discussion Paper | Discussion Paper | Discussion Paper

Title Page

Abstract Introduction

Conclusions References

Tables Figures

◀ ▶

◀ ▶

Back Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



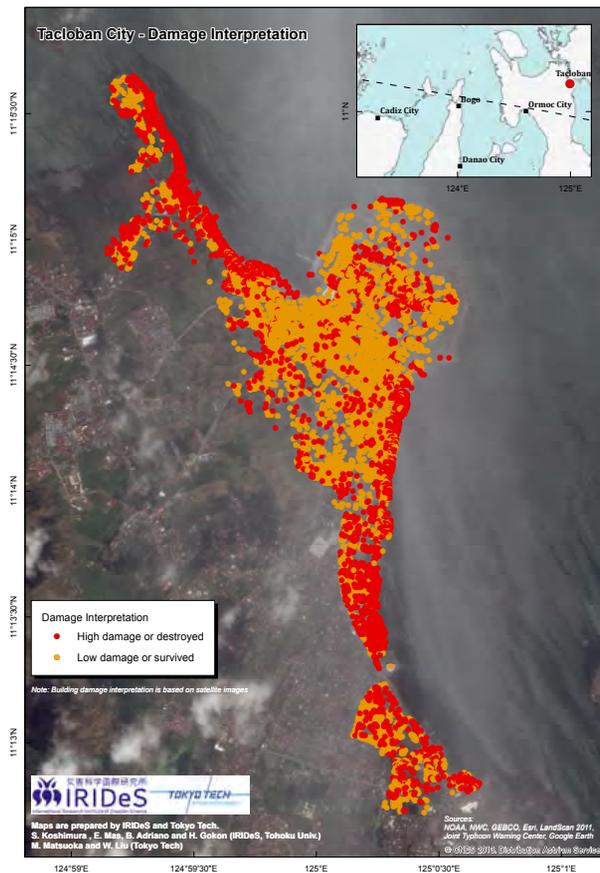


Figure 3. The results of the visual damage assessment using pre- and post-event satellite images and two classification criteria. (i) High damage or destruction in red and (ii) low damage or survival in orange.

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page	
Abstract	Introduction
Conclusions	References
Tables	Figures
◀	▶
◀	▶
Back	Close
Full Screen / Esc	
Printer-friendly Version	
Interactive Discussion	



Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.



Figure 4. Photos taken during the field survey at the areas assessed through visual inspection of satellite images. The damage conditions and distribution confirm the interpretation that higher damages existed to the north and south of the downtown area in Tacloban city, the Philippines.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



NHESSD

2, 3741–3767, 2014

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

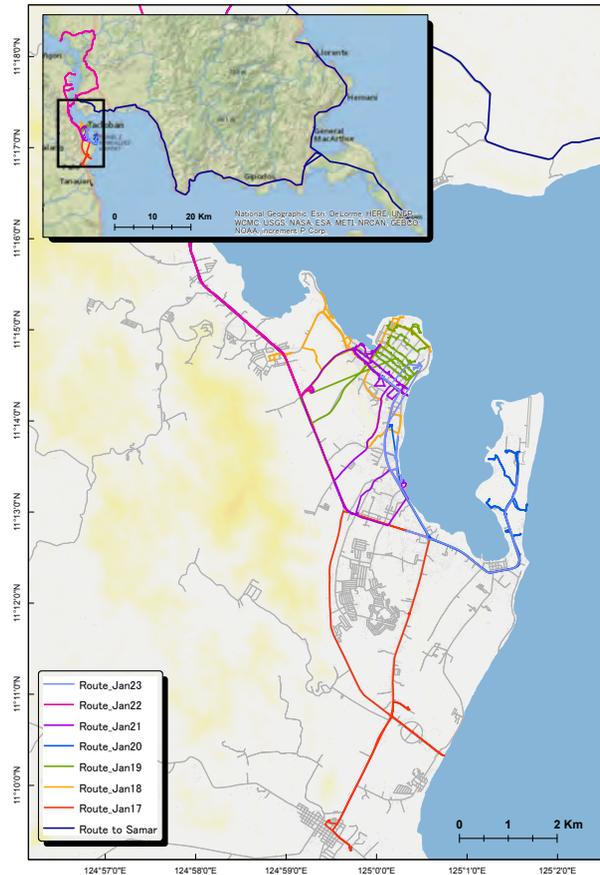


Figure 6. The coloured lines show the daily survey routes of the team. Areas surveyed: Palo, Candahug (McArthur Park), Tacloban Airport, Magallanes, Downtown Tacloban (green route), Anibong, North Leyte, West and East Samar, Guiuan and Hernani.

Title Page	
Abstract	Introduction
Conclusions	References
Tables	Figures
◀	▶
◀	▶
Back	Close
Full Screen / Esc	
Printer-friendly Version	
Interactive Discussion	



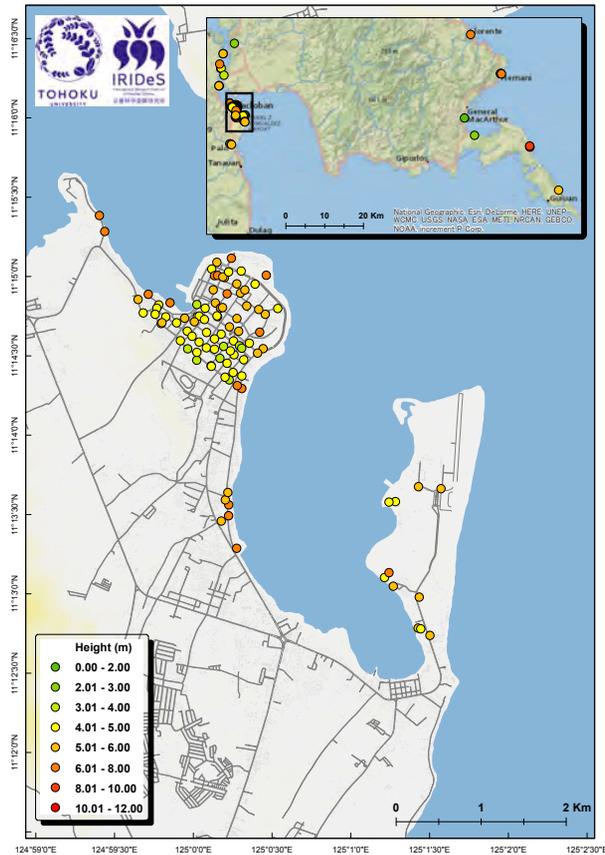


Figure 7. Level of storm surge inundation (Leyte Is. and West Samar Is.) and surface wave heights (East Samar Is.) with respect to the local mean sea level.

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page	
Abstract	Introduction
Conclusions	References
Tables	Figures
◀	▶
◀	▶
Back	Close
Full Screen / Esc	
Printer-friendly Version	
Interactive Discussion	



**Survey of the 2013
Super Typhoon
Haiyan**

E. Mas et al.



Figure 8. (A, B) Damage observed at the School of Health Science at the University of the Philippines, Manila. (C) Damage to the Provincial Health Office building in Palo. (D) The South Korean army helping with the restoration of a local hospital in Palo.

[Title Page](#)[Abstract](#)[Introduction](#)[Conclusions](#)[References](#)[Tables](#)[Figures](#)[◀](#)[▶](#)[◀](#)[▶](#)[Back](#)[Close](#)[Full Screen / Esc](#)[Printer-friendly Version](#)[Interactive Discussion](#)

NHESSD

2, 3741–3767, 2014

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.



Figure 9. (A, B) Damage to the walls and roof of a gate to the side of the runway. (C) Passengers arriving and baggage claim belt out of service due to damage.

**Survey of the 2013
Super Typhoon
Haiyan**

E. Mas et al.



Figure 10. (A) Watermark in the inland downtown area, where no structural damage was observed. (B) Inland downtown, damage to doors due to flooding. (C, D) Extensive damage at the coastline near downtown Tacloban.

[Title Page](#)[Abstract](#)[Introduction](#)[Conclusions](#)[References](#)[Tables](#)[Figures](#)[◀](#)[▶](#)[◀](#)[▶](#)[Back](#)[Close](#)[Full Screen / Esc](#)[Printer-friendly Version](#)[Interactive Discussion](#)

**Survey of the 2013
Super Typhoon
Haiyan**

E. Mas et al.



Figure 11. Damage observed at the Anibong area, north of downtown Tacloban. Destruction of wooden pile dwellings, erosion and local instability of slopes.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures



Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion



Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.



Figure 12. Damage at the northern part of Leyte Island. **(A)** Structure near the San Juanico Bridge. Inundation height was measured at 5.9 m. **(B, C)** Coastal village of Old Kauayan, a small sea wall was overtopped and damaged. Surge flooding of 4.4 m was measured here. **(D)** Sea wall damage at Tagpuro. The runup height was 6.9 m. **(E)** Barangay Rosal area with a 5.0 m storm surge inundation and damage to houses behind the 3.0 m sea wall.

NHESSD

2, 3741–3767, 2014

**Survey of the 2013
Super Typhoon
Haiyan**

E. Mas et al.



Figure 13. Guiuan village, one of the areas most affected by surface waves. Sand erosion, vegetation damage and concrete structures destroyed.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures

◀

▶

◀

▶

Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion





Figure 14. Jagnaya Beach area, east of Salcedo village. Extensive sand erosion and deposition to inland was observed. In addition, coral boulders were observed on the beach, which were possibly carried inland by the waves.

Survey of the 2013 Super Typhoon Haiyan

E. Mas et al.

Title Page

Abstract

Introduction

Conclusions

References

Tables

Figures

◀

▶

◀

▶

Back

Close

Full Screen / Esc

Printer-friendly Version

Interactive Discussion

