

# Stability assessment of roadbed affected by ground subsidence adjacent to urban railways

Ki-Young Eum<sup>1</sup>, Young-Kon Park<sup>2</sup>, Sang-Soo Jeon<sup>3</sup>

<sup>1</sup>Advanced infrastructure research team, Korea Railroad Research Institute, Chuldobakmulgwan-Ro 176, Uiwang City, Gyeonggi-Do 16105, South Korea

<sup>2</sup>Smart station research team, Korea Railroad Research Institute, Chuldobakmulgwan-Ro 176, Uiwang City, Gyeonggi-Do 16105, South Korea

<sup>3</sup>Department of Civil and Urban Engineering, Inje University, Inje-Ro 197, Gimhae City, Kyungsangnam-Do 50834, South Korea

*Correspondence to:* Sang-Soo Jeon ([ssj@inje.ac.kr](mailto:ssj@inje.ac.kr))

**Abstract.** In recent years, leakages in aged pipelines for water and sewage in urban areas have frequently induced ground loss resulting in cavities and ground subsidence causes the roadbed settlement greater than the allowable value. In this study, FLAC<sup>3D</sup>, which is a three-dimensional finite-difference numerical modeling software, is used to do stability and risk level assessment for the roadbed adjacent to urban railways with respect to various groundwater levels and the geometric characteristics of cavities. Numerical results show that roadbed settlement increases as the diameter (D) of the cavity increases and the distance (d) between the roadbed and the cavity decreases. The regression analyses results show that, as D/d is greater than 0.2 and less than 0.3, the roadbed is in the status of caution or warning. It requires a database of measurement sensors for real-time monitoring of the roadbed, structures and groundwater to prevent disasters in advance. As D/d exceeds 0.35, the roadbed settlement, which substantially increases and the roadbed is in the status of danger. Since it may result in highly probable traffic accident, train operation should be stopped and the roadbed should be reinforced or repaired. The effects of groundwater level on the roadbed settlement are examined and the analyses results indicate that a roadbed settlement is highly influenced by groundwater levels to an extent greater than even the influence of the size of the cavity.

## 1 Introduction

Urban railways in South Korea have been initiated from the Seoul subway 1<sup>st</sup> line in 1974 and have been operating in Seoul city and several metropolitan cities. The number of passengers using urban railway are being increased and it has played a significantly important role in public transportation for urban development. Urban railway is defined as transportation facility and method for smooth transportation in the city and includes light rail transit and subway as indicated in the law of urban railway (Ministry of land, 2017).

Risk management associated with safety is a fundamental focus in railway operations. It has been integrated into global safety management system of railways (Berrado et al., 2010) and developed to allow a rapid risk assessment using a common risk score matrix (Braband, 2011). As roadbed settlements exceed the allowable limits, it may result in track irregularity and derailments of trains causing heavy loss of life. Therefore, risk management tools are developed to deal with track safety by controlling and reducing the risk of derailments (Zarembski et al., 2006). In this study, methods to secure the stability of roadbeds have been examined using numerical analysis.

Numerical analyses have been widely used for risk assessment. Numerical analyses using three-dimensional geotechnical codes were carried out to predict the subsidence area and its interaction with buildings (Castellanza et al., 2015) and a three-dimensional groundwater flow model for risk evaluation was developed to be an effective management strategy (Ashfaque et al., 2017). The coupling of numerical models and monitoring data contribute to undertake efficient risk reduction policies (Bozzano et al., 2013). Especially using FLAC, which is a finite-difference numerical code especially specialized in the area of geotechnical engineering, numerical computations to simulate the influence of rainfall (Pisani, 2010), both acoustic emission (AE) activities at AE sensor locations of

48 the Kannagawa cavern (Cai et al., 2007), and a comprehensive pump test at Sellafield (Hakami, 2001) showed  
49 good agreement with field monitoring results. In this study, FLAC<sup>3D</sup>, which is a three-dimensional finite-difference  
50 numerical code especially specialized in the area of geotechnical engineering, is adopted for numerical analysis.

51 Research on stability assessment and reinforcement of railway roadbeds has been actively carried out, but the  
52 effect of the cavity adjacent to urban railways on roadbed behavior has rarely studied. In recent years, the number  
53 of accidents induced by cavities larger than 2 m in diameter has increased especially in highly populated cities in  
54 South Korea. Therefore, the residents in these cities were terrified of cavities after the accidents (Shin and Roh,  
55 2006). Especially, ground subsidence near subways due to self-weight and/or surcharge loading was around 60%  
56 (Lee and Kang, 2014). Changes in groundwater levels may cause increased occurrences of ground subsidence  
57 because the lowering of groundwater levels lead to ground settlement (Lee et al., 2015). Groundwater level  
58 influences both ground settlement and stability of underground structures. Deep excavation of the ground adjacent  
59 to urban railways has a significance influence on the allowable tensile strength of underground structures (Lee at  
60 al., 2017). If large underground cavities are located at nearby roadbeds, there is a high potential of ground  
61 subsidence.

62 Ground subsidence (Fig. 1) in South Korea occurred at nearby urban railways most recently (Kyunghang times,  
63 2016). The ground subsidence (Fig. 1a) occurred with a cavity of depth 5 m, width 8 m, and length 80 m near the  
64 Seokchon subway station in Seoul City. The accident was induced by the inappropriate deep excavation near the  
65 subway. The ground subsidence (Fig. 1b) was caused by the leakage of a water pipeline with a large-scale cavity  
66 of depth 21 m, width 11 m, and length 12 m near Bakchon subway station in Incheon City (Newshankuk, 2016).  
67 The ground subsidence (Fig. 1c) occurred near Samseongjungang subway station. Six cavities were found almost  
68 simultaneously in Seoul City (Kyunghang times, 2016). A small-scale cavity of depth 2.2 m (Fig. 1d) occurred  
69 near Janghanpyeong subway station in Seoul City, but the cause of this accident has not been clarified. The  
70 accident was assumed to be caused by inappropriate recovery construction near subway extension.

71 Ground subsidence with a cavity having depth 3.6 m (Fig. 1e) occurred as the replacement work of a sewage  
72 pipeline was carried out at Texas in the US (Wikitree, 2016). Ground subsidence with a cavity having a width of  
73 15 m (Fig. 1f) occurred as tunnel excavation work for subway extension was carried out at Fukuoka in Japan  
74 (Chosun Ilbo, 2016). Ground subsidence with a cavity of width 25 m (Fig. 1g) occurred as a 50 m tunnel  
75 excavation near the light rail transit was carried out at Ottawa in Canada (Yonhap news, 2016). Ground subsidence  
76 with a cavity of depth 10 m (Fig. 2h) occurred as subway construction was carried out near Guangzhou in China  
77 (Sisa china, 2016). Ground subsidence with a large-scale cavity in urban areas is highly correlated with the  
78 undiscerned development of urban areas, abuse of groundwater and inappropriate underground construction.

79



81 **Figure 1.** Ground subsidence nearby subway of urban railway: (a) Seokchon subway station, (b) Bakchon subway station, (c)  
82 Samseongjungang subway station, (d) Janghanpyeong subway station in South Korea, (e) Texas in the US, (f) Fukuoka in  
83 Japan, (g) Ottawa in Canada, and (h) Guangzhou in China.

84

85 80% of the ground subsidence occurred from 2010 until the beginning of 2014 in Seoul City was induced by  
86 aged pipelines for water and sewage (Oh et al., 2015). Since 48% and 30% of sewage pipelines in Seoul city were  
87 constructed more than thirty and fifty years ago, respectively. Aged pipelines for water and sewage pipelines cause

88 numerous cavities in the near future (The Segye times, 2016).

89 As a cavity exists at the center of the railway track in the box structures of urban railways, its influence on box  
90 structures and roadbed settlements has been examined to observe the effects of cavities adjacent to the roadbeds of  
91 urban railways (Lee et al., 2015). A method to establish a database was proposed to prevent and manage the  
92 disasters (Choi et al., 2007).

93 As a cavity exists adjacent to the roadbed, in this study, a three-dimensional numerical analysis using FLAC<sup>3D</sup> is  
94 carried out to assess both roadbed stability and risk level with respect to the distance between the center of the  
95 roadbed and the center of the cavity, diameter of the cavity, and groundwater levels.

## 96 97 **2 Numerical analysis** 98

99 In the following sections, the FLAC<sup>3D</sup> given in this work are briefly described in the following sections by  
100 paraphrasing from those of Itasca Consulting Group (2002).

### 101 102 **2.1 Theoretical background of FLAC<sup>3D</sup>** 103

104 FLAC<sup>3D</sup> (Fast Lagrangian Analysis of Continua in three Dimensions) is numerical modeling software for advanced  
105 geotechnical analysis of soil, rock, groundwater, and ground support in three dimensions. FLAC is used for  
106 analysis, testing, and design by geotechnical, civil, and mining engineers (Itasca Consulting Group Inc., 2002). It is  
107 designed to accommodate any kind of geotechnical engineering project that requires continuum analysis. The  
108 mechanics of the medium are derived from general principles (definition of strain, laws of motion), and the use of  
109 constitutive equations defining the idealized material. The resulting mathematical expression is a set of partial  
110 differential equations, relating mechanical (stress) and kinematic (strain rate, velocity) variables, which are to be  
111 solved for particular geometries and properties, given specific boundary and initial conditions. An important aspect  
112 of the model is the inclusion of the equations of motion, although FLAC3D is primarily concerned with the state of  
113 stress and deformation of the medium near the state of equilibrium. Application of the continuum form of the  
114 momentum principle yields Cauchy's equations of motion:

$$115 \sigma_{ij,j} + \rho b_i = \rho(d_{vi}/d_t) \quad (1)$$

116  
117  
118 Where  $\sigma$  is the symmetric stress tensor,  $\rho$  is the mass per unit volume of the medium,  $[b]$  is the body force per  
119 unit mass, and  $d[v]/dt$  is the material derivative of the velocity. These laws govern, in the mathematical model,  
120 the motion of an elementary volume of the medium from the forces applied to it. Note that in the case of static  
121 equilibrium of the medium, the acceleration  $d[v]/dt$  is zero, and Eq. (1) reduces to the partial differential  
122 equations of equilibrium:

$$123 \sigma_{ij,j} + \rho b_i = 0 \quad (2)$$

### 124 125 126 127 **2.2 Conditions for numerical analysis** 128

129 The Mohr-Coulomb failure model has been used for the analysis (Itasca Consulting Group Inc., 2015). Since there  
130 are various causes and sizes of the cavity of ground subsidence occurring near urban railway, it is very difficult to  
131 simulate the process of cavity generation. A circular cavity below the ground surface has been modeled with  
132 respect to diameters (D) of 4 -10 m, which is selected by historical events as described in previous section.  
133 Distances of 15-25 m from the cavity to the center of the roadbed and various groundwater levels are arbitrarily  
134 selected for roadbed settlement influenced by given size of cavity. The analysis is performed based on the  
135 configuration of the analysis (Fig. 2). As shown in the figure, roller supports prevent normal translations, but  
136 capable of tangential translations and/or rotations. There is a single linear reaction force in either vertical or  
137 horizontal directions.

142  
 143  
 144  
 145  
 146  
 147  
 148  
 149  
 150  
 151  
 152  
 153  
 154  
 155  
 156  
 157  
 158  
 159  
 160  
 161  
 162  
 163  
 164  
 165  
 166  
 167  
 168  
 169  
 170  
 171  
 172  
 173  
 174  
 175  
 176

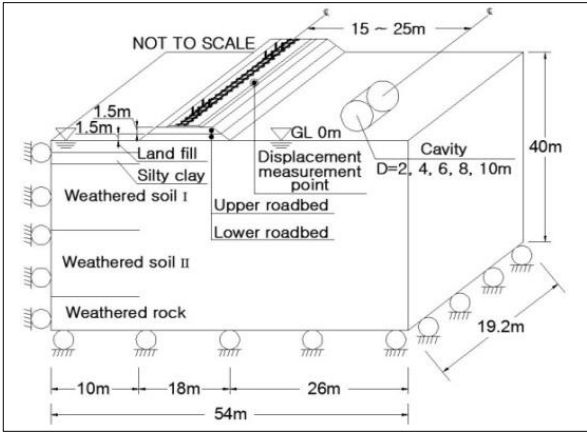


Figure 2. Configuration of the railway roadbed and cavity

An embankment consists of the lower roadbed, upper roadbed, and gravel ballast. The roadbed width at the bottom of the ballast is 8m. The widths of its bottom and top are 5.1 and 3.3 m, respectively, and its slope is 1:1.8. In-situ soil consists of reclaimed soil, silty clay, weathered soil, and weathered rock. Its physical properties listed in Table 1 are obtained from lab experiments of soil sampled at a construction site.

KS60 rail and prestressed concrete (PC) sleeper commonly used in gravel ballast have been used for the numerical analysis. A rail pad, which is widely used to minimize vibration and impact loading during train operation is made of ethylene vinyl acetate (EVA). However, in this study, a thermoplastic polyurethane (TPU) rail pad, which is more economical and has higher tensile strength has been used for the numerical analysis. Its properties are listed in Table 1. The beam element is used for the rail and rail pad.

An axial load of the urban railway train (16 tons) is applied for the numerical analysis. The effective loading is estimated by multiplying 1.2 with half of the axial load considering a wheel loading increment of 20% and a marginal safety of deficiency of the cant. Dynamic loading to reflect dynamic impact ratio (Fig. 3) was estimated by multiplying 1.2 with the effective loading (Ministry of land, 2013).

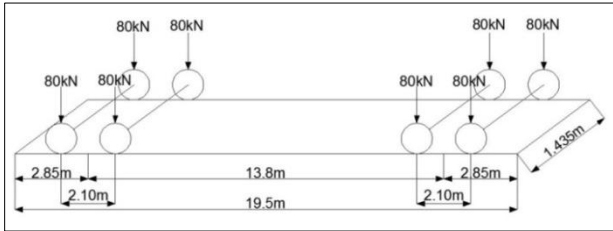


Figure 3. Configuration of the train load

In general, an allowable settlement of 10 mm has been recommended in South Korea. The vibratory loading induces the gravel to be in a loose state, and frequent repairs of ballasts are required. Therefore, an allowable settlement of 2.5 mm is used to attain additional marginal safety considering the compressive displacement of both the rail pad and ballasts, settlement of rail, ride quality, and both water inflow and cracks in the pavement surface of roadbeds (Jeon, 2014).

177  
 178  
 179  
 180  
 181  
 182  
 183  
 184  
 185  
 186  
 187  
 188  
 189  
 190

191  
192

**Table 1.** Physical properties of soil, rail, PC sleeper and the rail pad

	Soil type	Height (m)	Unit weight (kN/m <sup>3</sup> )	Elastic modulus (kPa)	Poisson's ratio (ν)	Cohesion (kPa)	Friction angle (°)	Coefficient of permeability (cm/s)	K <sub>o</sub>
Soil	Ballast stone	0.3	19.0	133,900	0.30	-	35	-	0.43
	Upper roadbed	1.5	18.0	81,600	0.20	3.0	32	-	0.47
	Lower roadbed	1.5	18.0	51,000	0.30	10.0	30	-	0.50
	Land fill	1.5	17.0	30,000	0.35	5.0	24	1.0×10 <sup>-3</sup>	0.59
	Silty clay	1.5	17.0	20,000	0.35	5.0	25	5.0×10 <sup>-4</sup>	0.58
	Weathered soil I	15.0	19.0	75,000	0.33	10.0	30	1.0×10 <sup>-4</sup>	0.50
	Weathered soil II	15.0	19.0	70,000	0.33	10.0	33	1.0×10 <sup>-4</sup>	0.46
	Weathered rock	7.0	20.0	110,000	0.31	60.0	42	1.0×10 <sup>-5</sup>	0.33
KS60 rail	Area (mm <sup>2</sup> )	Unit weight (kN/m <sup>3</sup> )		Elastic modulus (kPa)		Moment of inertia(m <sup>4</sup> )			
						I <sub>xx</sub>	I <sub>yy</sub>		
		7,741	77.5	21,000×10 <sup>4</sup>		30,820×10 <sup>-9</sup>	5,120×10 <sup>-9</sup>		
PC sleeper	Length (m)	Width (m)		Height (m)		Interval between sleepers (m)			
		2.45	0.28	0.20		0.58			
Rail pad	Thickness (mm)	Unit weight (kN/m <sup>3</sup> )		Vertical spring coefficient of rail pad (kPa)					
		5	11.5	15.3×10 <sup>7</sup>					


193  
194  
195  
196  
197  
198  
199  
200  
201  
202  
203  
204  
205  
206  
207  
208  
209  
210  
211  
212  
213

### 3 Results and discussion

#### 3.1 Roadbed settlement


The ground settlement in backfill area due to the excavation work has been estimated (Kojima et al., 2005; Kung et al., 2009; Ou et al., 2013) and its effect on responses of adjacent buildings has been investigated (Lin et al., 2017; Sabzi and Fakher, 2015; Schuster et al., 2009) have been widely studied. Clough and O'Rourke (1990) have proposed the method to estimate settlement in clay and sandy soils for in-situ wall systems using field measurement data and finite element analysis (Fig. 4). H, d, δ<sub>vm</sub>, and δ represent an excavation depth, a distance from the wall, the maximum settlement, and a settlement with respect to the distance, respectively. The settlements tend to average about 0.15% H. δ<sub>vm</sub> occurs in the middle of excavation depth near the wall and a settlement linearly decreases as d increases. Little settlement occurs as d = 2H. Empirical correlations of settlement with d proposed by Bowels (1988) and Peck (1969) were similar to the one proposed by Clough and O'Rourke (1990). Bowels (1988) suggested that the settlements tend to average about 0.13 ~ 0.18% H. The magnitude of settlements is influenced by the ground stiffness, the wall stiffness, and support spacing. In this study, although ground is not fully excavated and also there are no wall systems, the settlement resulting from stress release in ground similarly occurs.

214  
 215  
 216  
 217  
 218  
 219  
 220  
 221  
 222  
 223  
 224  
 225  
 226  
 227  
 228  
 229  
 230  
 231  
 232  
 233  
 234  
 235

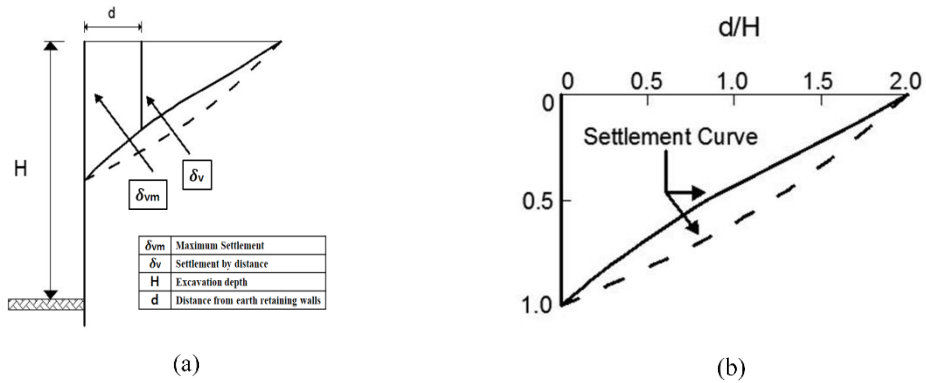

**Figure 4.** Settlement of clay and sand backfill with respect to the distance from earth retaining walls: (a) Settlement of backfill and (b) Prediction of settlement

The contours of ground settlement are presented for how the roadbed (Fig. 5) is influenced by a cavity adjacent to the urban railways. The contours of ground settlement are presented for cavities with diameters of 8 and 10 m, respectively, at a distance of 20 m between the center of the roadbed and the center of the cavity. As shown in the figures, ground settlement increases as the diameter of the cavity increases. As a cavity is generated on the right side of the roadbed, the right end of the roadbed is significantly settled down.

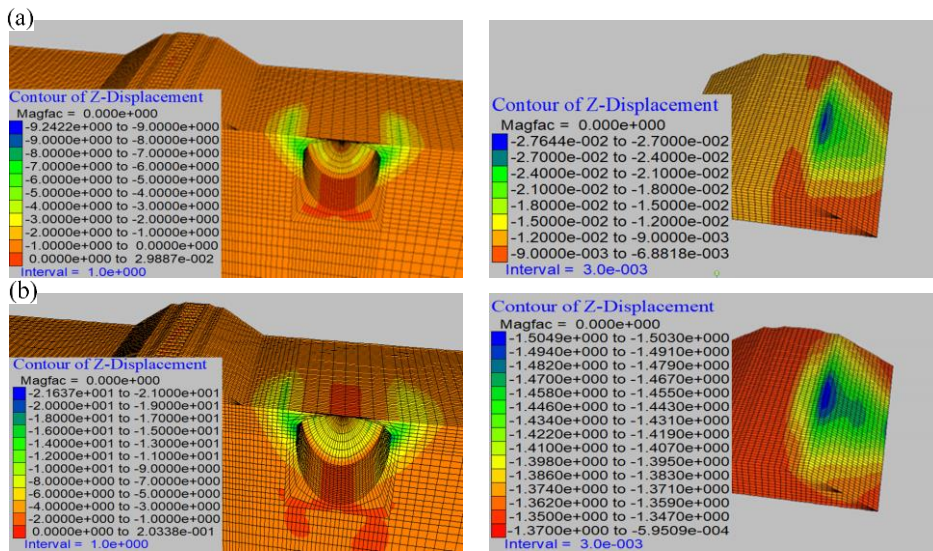


**Figure 5.** Vertical displacement contour of the roadbed at a distance of 20 m between the center of roadbed to the center of the cavity=20 m with respect to diameter of the cavity: (a) Diameter = 8 m and (b) Diameter = 10 m.

The analysis results (Fig. 6) are presented for cavities with diameters of 4 -10 m. As the variation from 15 to 20 m in the distances between the center of the roadbed and the center of the cavity is applied to the 10 m cavity, roadbed settlements are calculated with respect to various diameters of the cavity. The cavity with a diameter of 10 m at a distance of 20 m has little influenced on the roadbed. However, as the diameter of the cavity at the same distance exceeds 10 m, the roadbed settlement exceeds the allowable value. **As cavities with diameters of 8 and 6 m are generated, at distances less than 18 and 15 m, where d is close to or less than 2H (2D), it may exceed the allowable settlement resulting in an accident.**

Roadbed settlement increases as the diameter (D) of the cavity increases and the distance (d) between the roadbed and the cavity decreases. Therefore, in this study, the roadbed settlement is examined with respect to D normalized by d (Fig. 7). The regression analyses results show medium to high correlations of  $r^2=0.72$ . **As D/d is greater than 0.2 and less than 0.3, the roadbed settlement is approximately 5 mm. It requires that a database of**


236  
 237  
 238  
 239  
 240  
 241  
 242  
 243  
 244  
 245  
 246  
 247  
 248  
 249  
 250

251 measurement sensors should be established for real-time monitoring of the roadbed, structures and groundwater to  
 252 prevent disasters in advance. As  $D/d$  exceeds 0.35, the roadbed settlement substantially increases and is greater  
 253 than 10 mm. Since it may result in highly probable traffic accident, train operation should be stopped and the  
 254 roadbed should be reinforced or repaired.  
 255

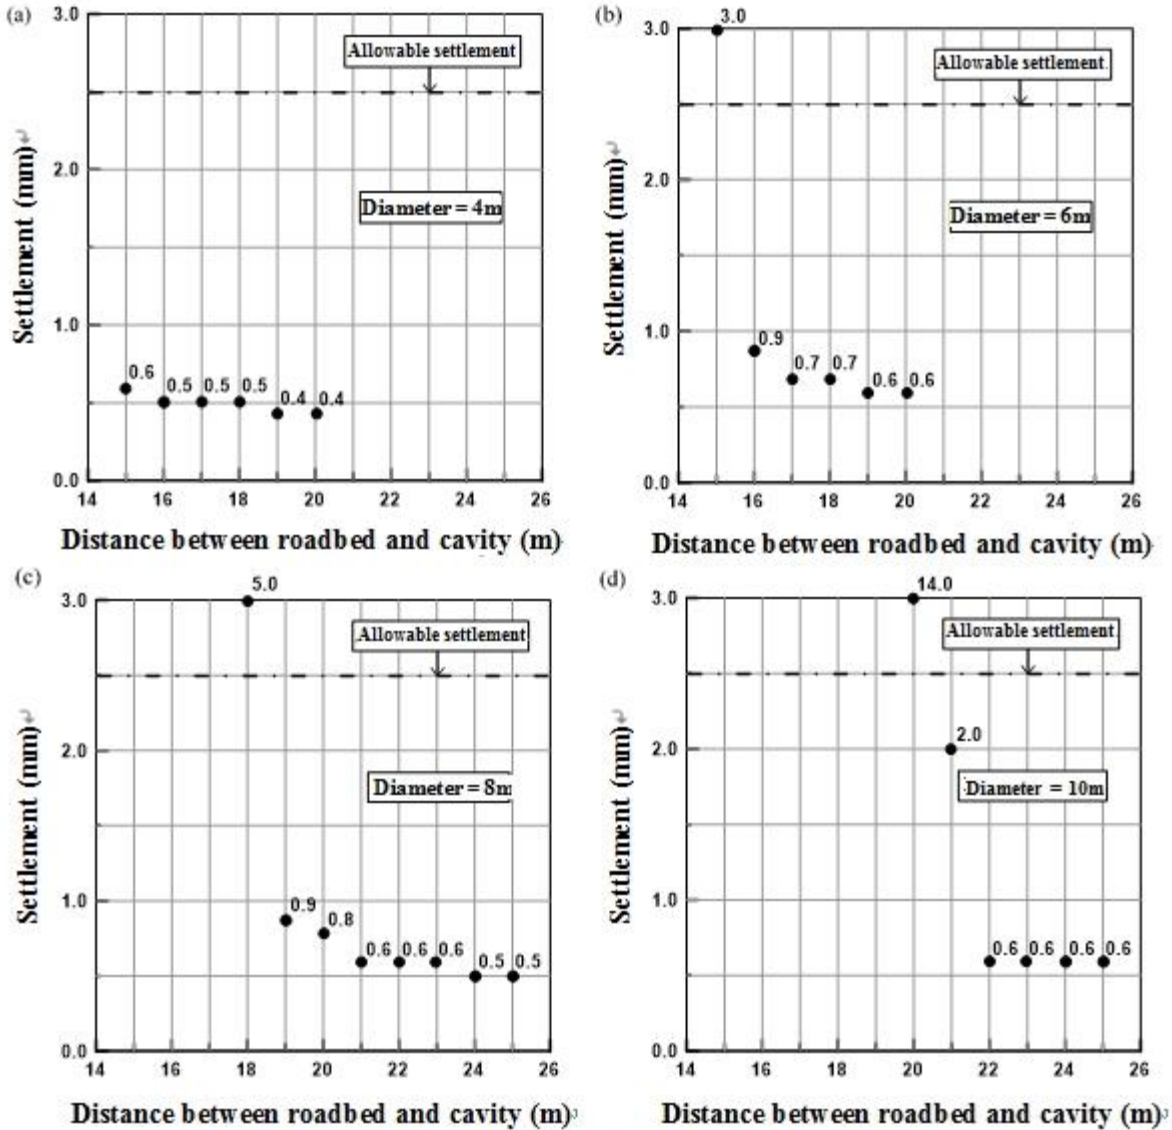

256  
 257  
 258 **Figure 6.** Roadbed settlement with respect to distance between roadbed and cavity: (a) Diameter = 4 m, (b) Diameter = 6 m,  
 259 (c) Diameter = 8 m, and (d) Diameter = 10 m.

260  
 261 The risk level has been estimated by the occurrence of roadbed settlements. Its risk level has been defined by the  
 262 value of the roadbed settlements relative to the allowable settlement. The risk level is defined as safe (not  
 263 problematic for both ride quality and track repair), caution (not problematic for track repair), warning (between  
 264 caution and danger), and danger (highly probable traffic accident) as a settlement is equal to or less than 2.5 mm,  
 265 greater than 2.5 mm and equal to or less than 4 mm, greater than 4 mm and equal to or less than 9mm, and greater  
 266 than 9 mm, respectively.

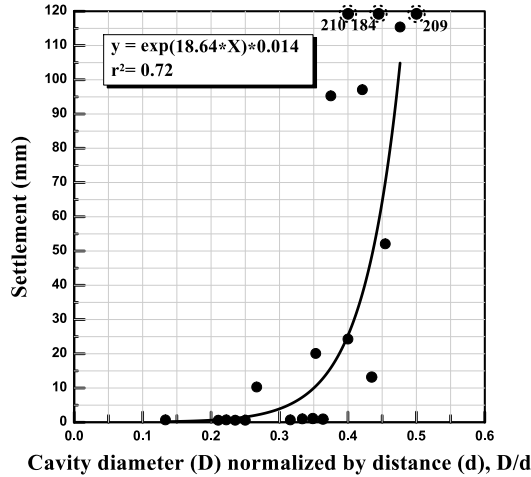


267  
268  
269 **Figure 7.** Regression analysis of roadbed settlements with respect to the diameter of the cavity and distance between roadbed  
270 and the cavity  
271

272  
273 **3.2 Effects of groundwater level**  
274

275 In this study, the effects of groundwater level on the roadbed settlement are examined and it is lowered until the  
276 allowable settlement value of the roadbed is satisfied. The maximum distance between the roadbed and the cavity  
277 for the analysis is determined as the maximum value for the satisfied allowable settlement with no groundwater  
278 condition. A stability assessment of the roadbed has been carried out at the distance of 20 m for both 4 and 6 m  
279 diameter cavities and at 25 m for both the 8 and 10 m diameter cavities.


280 The contours of ground settlement (Fig. 8) are presented to examine the groundwater level (GWL) effects in the  
281 case of the 8 m diameter cavity located at a distance of 25 m from the roadbed to cavity. The contours of ground  
282 settlement are presented with GWL on the ground surface and 20 m below it, respectively (Figs. 8a and 8b). The  
283 settlement of the roadbed is highly subject to groundwater levels.  
284  
285

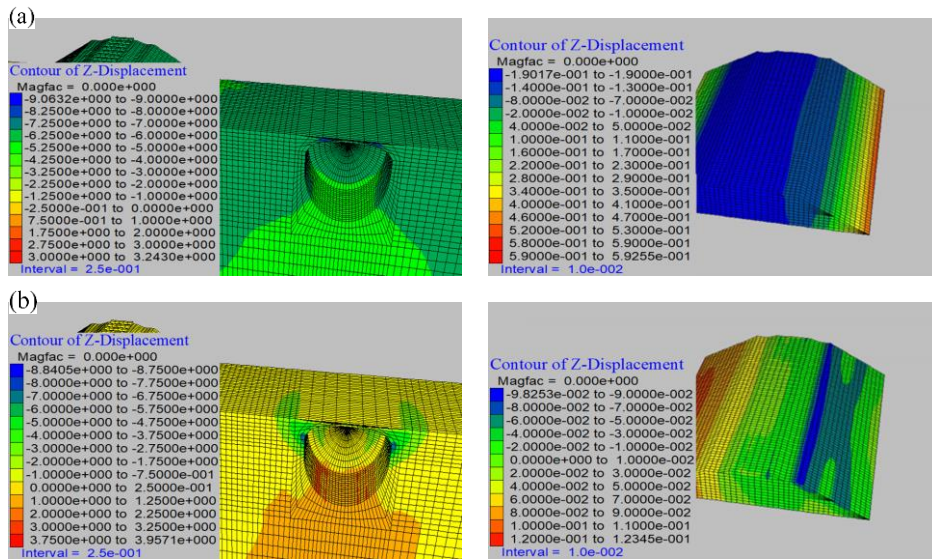

286 **Figure 8.** Vertical displacement contours of the roadbed for a cavity diameter 8 m, at the roadbed-to-cavity distance of 25 m: (a)  
287 GWL = ground surface and (b) GWL = (-) 8 m.



288 The roadbed settlement (Fig. 9) is highly influenced by groundwater. Ground settlement for 4 and 6 m diameter  
 289 cavities located at a distance of 20 m from the roadbed (Figs. 9a and 9b) satisfies the allowable value for GWL = (-)  
 290 4 and (-) 12m, respectively. The ground settlement for 8 and 10 m diameter cavities located at a distance of 25 m  
 291 from the center of the roadbed (Figs. 9c and 9d) has substantially decreased as groundwater level is 8 and 15 m  
 292 below the ground surface, respectively, and satisfies the allowable value as its level is 18 and 22 m below the  
 293 ground surface, respectively. It indicates that a roadbed settlement is highly influenced by groundwater levels to an  
 294 extent greater than even the influence of the size of the cavity.  
 295

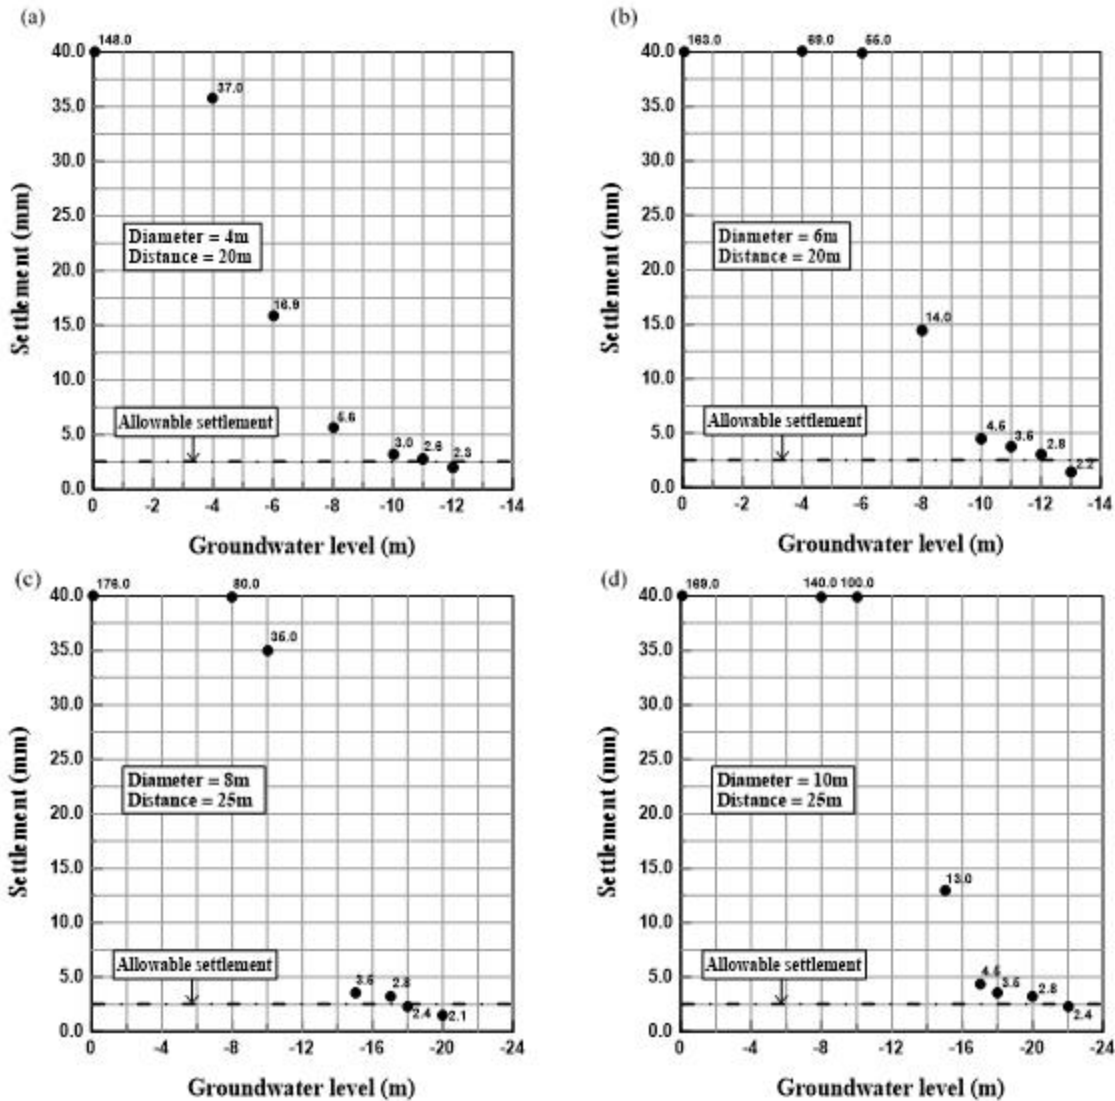


296  
 297 **Figure 9.** Roadbed settlement with respect to the groundwater level: (a) Diameter of the cavity = 4 m and distance of roadbed  
 298 from the center of the cavity = 20 m, (b) Diameter of the cavity = 6 m and distance of the roadbed from the center of cavity =20  
 299 m, (c) Diameter of the cavity = 8 m and distance of the roadbed from the center of cavity = 25 m, and (d) Diameter of the cavity  
 300 = 10 m and the distance of the roadbed from the center of the cavity = 25 m.  
 301

302 **3.3 Risk level assessment of roadbed**


303  
 304 Roadbed settlements induced by the cavity near urban railways have been estimated with respect to the

305 groundwater level, distance between the roadbed and cavity, and size of the cavity. As listed in Table 2, the  
 306 roadbed settlement increases as the size of the cavity increases and the cavity is located close to the roadbed. As  
 307 listed in Table 2, the roadbed settlement for no groundwater condition is less than the allowable value, whereas it is  
 308 in extreme danger when groundwater is present. When it is in the status of danger, train operation should be  
 309 stopped and the roadbed should be reinforced or repaired. When it is in the status of caution or warning, a database  
 310 of measurement sensors for urban railways should be established for real-time monitoring of the roadbed,  
 311 structures and groundwater for disaster prevention.  
 312


313 **Table 2.** Risk level of the roadbed with respect to the diameter of the cavity and the distance between the roadbed to the cavity  
 314 for the groundwater condition  
 315 (Computation time: 3 weeks)

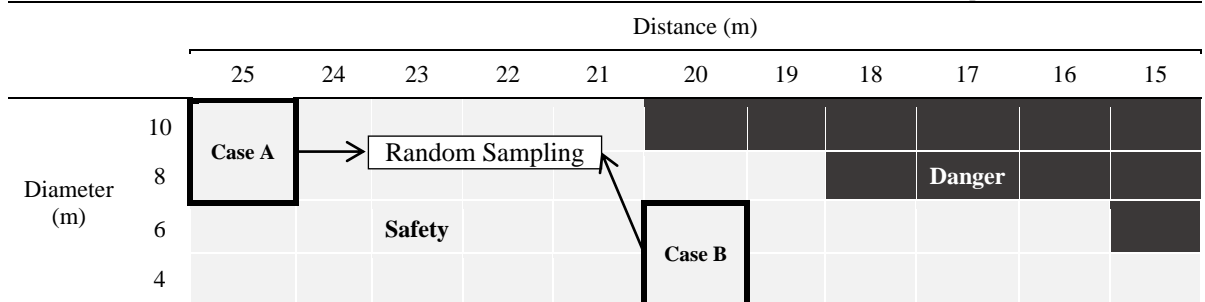

316 (Computation time: 4 days)

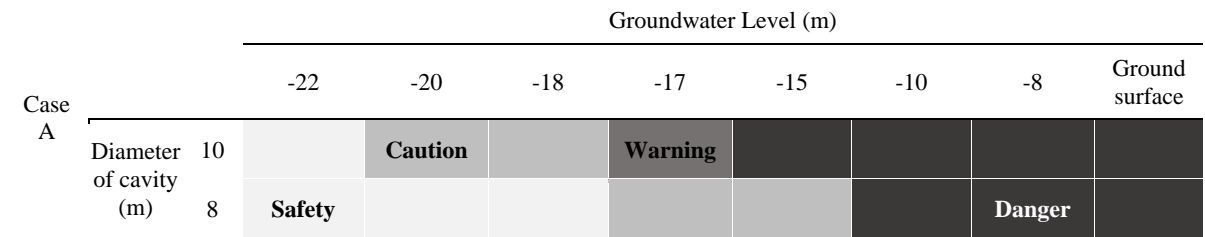

317 (Computation time: 3 days)

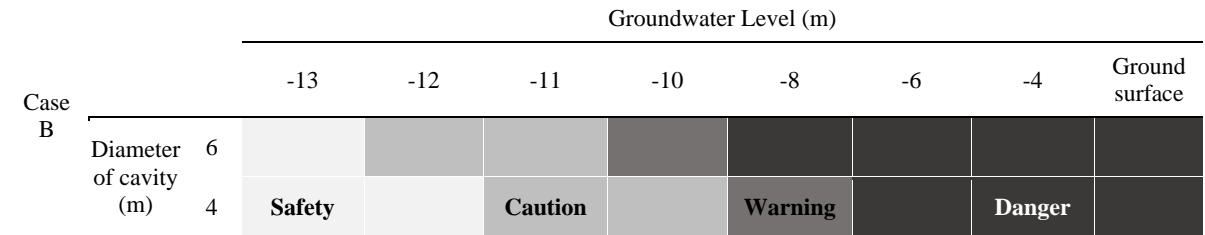

\* Safety(Settlement ≤ 2.5mm), Caution(2.5mm < Settlement ≤ 4.0mm), Warning(4.0mm < Settlement ≤ 9.0mm), Danger(9.0mm < Settlement)

318  
 319 **4 Conclusions**  
 320

321 The number of occurrences of ground subsidence induced by a leakage of aged pipelines for water and sewage in  
 322 urban areas resulting in various sizes of cavity near the urban railway in Seoul City has been found to increase and  
 323 it may cause the roadbed settlement to exceed the allowable value. A large-scale cavity is rarely found, but if it is  
 324 close to the roadbed, the roadbed is highly influenced by the cavity and may cause train derailment.

325 In this study, numerical analyses are carried out to estimate roadbed stability and its risk level associated with  
 326 various groundwater levels, sizes of cavities. The analyses results show that roadbed settlement increases as the  
 327 diameter (D) of the cavity increases and the distance (d) between the roadbed and the cavity decreases. The  
 328 regression analyses results show that, as D/d is greater than 0.2 and less than 0.3, a database of measurement  
 329 sensors should be established for real-time monitoring of the roadbed, structures and groundwater to prevent  
 330 disasters in advance. As D/d exceeds 0.35, the roadbed settlement, which substantially increases and is in the status

331 of danger, may result in highly probable traffic accident. Therefore, train operation should be stopped and the  
332 roadbed should be reinforced or repaired. The effects of groundwater level on the roadbed settlement are examined  
333 at the distance of 20 m for both 4 and 6 m diameter cavities and at 25 m for both 8 and 10 m diameter cavities.  
334 Ground settlement for 4 and 6 m diameter cavities located at a distance of 20 m from the roadbed satisfies the  
335 allowable value for  $GWL = (-) 4$  and  $(-) 12m$ , respectively. The ground settlement for 8 and 10 m diameter cavities  
336 located at a distance of 25 m from the center of the roadbed has substantially decreased as  $GWL$  is 8 and 15 m  
337 below the ground surface, respectively, and satisfies the allowable value as its level is 18 and 22 m below the  
338 ground surface, respectively. It indicates that a roadbed settlement is highly influenced by groundwater levels to an  
339 extent greater than even the influence of the size of the cavity.

340

341 *Acknowledgements.* This work was supported by the 2017 INJE University research grant.

342

## 343 **References**

344

345 Ashfaqe, K., Kladias, M., Sager, S., and Schlekat, T.: Numerical modeling to evaluate hydrological dynamics and risk  
346 assessment of bottom ash ponds at a former coal-fired electric power plant, World of coal ash conference, 1-13, 2017

347 Berrado, A., El-Loursi, E., Cherkaoui, A., and Khaddour, M.: A Framework for Risk Management in Railway Sector:  
348 Application to Road-Rail Level Crossings. Open transportation Journal, Bentham Open, 19 p., 2010.

349 Braband, J.: Rapid Risk Assessment of Technical Systems in Railway Automation, Proc. Of the Australian System Safety  
350 Conference, 21 -26, 2011.

351 Bozzano, F., Cipriani, I., Esposito, C., Martino, S., Mazzanti, P., Prestininzi, A., Rocca, A., and Mugnozza, G. S.: Landslide  
352 risk reduction by coupling monitoring and numerical modeling, International conference Vajont 1963-2013. Thoughts and  
353 analyses after 50 years since the catastrophic landslide, 315-322, 2013

354 **Bowles, J. E.: Foundation analysis and design, 4<sup>th</sup> Ed., McGraw-hill, New York, 658-667, 1998.**

355 Cai, M., Kaiser, P. K., Morioka H., Minami, M., Maejima, T., Tasaka, Y., and Kurose, H.: FLAC/PFC coupled numerical  
356 simulation of AE in large-scale underground excavations, International Journal of Rock Mechanics & Mining Sciences, 44,  
357 550-564, 2007.

358 Castellanza, R., Orlandi, G. M., Prisco, C. di, Frigerio, G., Flessati, L., Fernandez Merodo J. A., Agliardi, F., Grisi, S., and  
359 Crosta, G. B.: 3D numerical analyses for the quantitative risk assessment of subsidence and water flood due to the partial  
360 collapse of an abandoned gypsum mine. IOP Conf. Series: Earth and Environmental Science, 26, 1-7, 2015.

361 Choi, C. Y., Kim, D. S., Lee, J. W., and Shin, M. H.: Development of Database System for Management of Roadbed Settlement  
362 in High Speed Railway, Proceedings of Korean Society for Railway Fall Conference, 496-500, 2007.

363 Chosunilbo: Excavations for 15-m diameter large-scale sinkhole Fukuoka in Japan, [http://news.chosun.com/site/data/html](http://news.chosun.com/site/data/html_dir/2016/11/08/2016110801318.html)  
364 [dir/2016/11/08/2016110801318.html](http://news.chosun.com/site/data/html_dir/2016/11/08/2016110801318.html), last access: December 2016.

365 **Clough, G. W., O'Rourke, T. D.: Construction Induced Movements of In situ Walls, Geotechnical Special Publication, ASCE,**  
366 **New York, 25, 439 - 470, 1990.**

367 Hakami, H.: Rock Characterisation facility (RCF) shaft sinking – numerical computations using FLAC, International Journal of  
368 Rock Mechanics & Mining Sciences, 38, 59-65, 2001.

369 Itasca Consulting Group, Inc: Outline of FLAC3D, <https://www.itascacg.com/software/flac3d#slideshow-6>, last access: June  
370 2017.

371 Itasca Consulting Group, Inc: FLAC3D Manual-Theory and Background, Minnesota, USA, 2002.

372 Jeon, S.-S.: Roadbed behavior subjected to tilting-train loading at rail joint and continuous welded rail, Journal of Central South  
373 University, 21, 2962-2969, 2014.

374 **Kojima, K., Ohta, H., Iizuka, A., and Tateyama, M.: A Simple Evaluation Method of Adjacent Ground Settlement due to**  
375 **Excavation Work, Proceedings of the 5<sup>th</sup> International Conference of TC28 of the ISSMGE, The Netherlands, 719-723, 2005.**

376 **Kung, G. T., Ou, C. Y., and Juang, C. H.: Modelling Small-strain Behaviour of Taipei Clays for Finite Element Analysis of**  
377 **Braced Excavations, Computers and Geotechnics, 36(1-2), 304-319, 2009.**

378 Kyunghang times: Additional finings of ground subsidence in Seckchon subway in Seoul,

379 [http://news.khan.co.kr/kh\\_news/khan\\_art\\_view.html?artid=201408211343301&code=940100](http://news.khan.co.kr/kh_news/khan_art_view.html?artid=201408211343301&code=940100), last access: December 2016.

380 Kyunghang times: '6; sinkholes concurrence at the same time' nearby Sanseongjungang of subway 9<sup>th</sup> line station,  
381 [http://sports.khan.co.kr/culture/sk\\_index.html?cat=view&art\\_id=201504031002483&sec\\_id=562901&pt=nv](http://sports.khan.co.kr/culture/sk_index.html?cat=view&art_id=201504031002483&sec_id=562901&pt=nv), last access:

382 December 2016.

383 Lee, H. J., Lee, Y. T., Choi, I. W., Lee, M. S., and Lee, T. G.: Investigation of Settlement of Concrete Track on High-Speed  
384 Railway Due to Groundwater Variation, Journal of the Korean Society for Railway, 20, 248-256, 2017.

385 Lee, J. H., Lee, H. S., and Lee, I. H.: IoT-based Convergence Technology for Urban Underground Sinkhole Prediction, in: 2015  
386 Summer meeting of The institute of electronics and information engineering, The institute of electronics and information  
387 engineering, 1735-1737, 2015.

388 Lee, K. Y. and Kang, S. J.: Causes and Countermeasures of Sinkhole Swallowed the City, Issue and Analysis, 156, 1-23, 2014.

389 Lee, S. J., Lee, J. W., Jung, Y. N., and Cho, H. J.: Sensitivity Analysis of the Deformations caused by Cavity Generation in

390 Subway Trackbed Foundation using the FEA, Proceedings of Korean Society for Railway Fall Conference, Yeosu, 1480-

391 1485, 2015.

392 Lin, H. D., Liao, H. C., Lin, K. J., Hsieh, Y. M., and Chen, C. C.: Excavation-induced Ground Settlements and responses of

393 adjacent building at various positions using 3D decoupled analysis method, Proceedings of the 19<sup>th</sup> International Conference

394 on Soil Mechanics and Geotechnical Engineering, Seoul, 1721-1724, 2017.

395 Ou, C.-Y., Teng, F.-C., Hsieh, P.-G., and Chien, S.-C.: Mechanism of Settlement Influence Zone due to Deep Excavation in

396 Soft Clay, Proceedings of the 18<sup>th</sup> International Conference on Soil Mechanics and Geotechnical Engineering, Paris, 2063-

397 2066, 2013.

398 Ministry of Land, Infrastructure and Transport, Seoul, Korea, available at: <http://www.molit.go.kr/portal.do>, last access: 15 June

399 2015.

400 Ministry of Land, Infrastructure and Transport.: Seoul, Korea, available at: <http://www.molit.go.kr/portal.do>, last access: 15

401 May 2017.

402 Newshankuk: Asphalt road in swallowed by sinkhole brief moment, [http://www.newshankuk.com/news/content.asp?fs=12&ss=57&news\\_idx=201202201707081291](http://www.newshankuk.com/news/content.asp?fs=12&ss=57&news_idx=201202201707081291), last access: December 2016.

403

404 Oh, D. W., Kong, S. M., Lee, D. Y., Yoo, Y. S., and Lee, Y. J.: Effects of Reinforced Pseudo-Plastic Backfill on the Behavior

405 of Ground around Cavity Developed due to Sewer Leakage, Journal of the Korean Geoenvironmental Society, 16, 13-22,

406 2015.

407 Peck, R. B.: Deep Excavations and Tunneling in Soft Ground. Proceedings of 7<sup>th</sup> International Conference on Soil Mechanics

408 and Foundation Engineering, Mexico City, State-of-the Art Volume, 225-290, 1969.

409 Pisani, G., Castelli, M., and Scavia, C.: Hydrogeological model and hydraulic behavior of a large landslide in the Italian

410 Western Alps. Nat. Hazards Earth Syst. Sci., 10, 2391-2406, 2010.

411 Sabzi, Z. and Fakher, A.: The Performance of Buildings adjacent to Excavation Supported by Inclined Struts, Journal of Civil

412 Engineering, 13(1), 1-13, 2009.

413 Segye Ilbo: Half of sewage pipelines left for thirty years without maintenance leads to disaster of sinkhole,

414 <http://www.segye.com/newsView/20150322002265>, last access: 3 December 2016.

415 Shin, E. C. and Roh, J. M.: Estimation of RPS Method Using 3-Dimensional Numerical Analysis, Journal of the Korean Society

416 for Railway, 9, 174-179, 2006.

417 Sisa China: Three of buildings one subsidence at Guangzhou in China, [http://sscn.kr/news/view.html?section=1&](http://sscn.kr/news/view.html?section=1&category=5&no=3561)

418 [category=5&no=3561](http://sscn.kr/news/view.html?section=1&category=5&no=3561), last access: December 2016.

419 Schuster, M., Kung, G. T. C., Juang, C. H., and Hashash, Y. M. A.: Simplified Model for Evaluating Damage Potential of

420 Buildings Adjacent to a Braced Excavation, Journal of Geotechnical and Geoenvironmental Engineering, ASCE, 135(12),

421 1823-1835, 2009.

422 Wikitree: "Giant sinkhole" resulting in rushed car and depth of sheriff, [http://www.wikitree.co.kr/main/news\\_view.php?id=284413](http://www.wikitree.co.kr/main/news_view.php?id=284413), last access: December 2016.

423

424 Yonhap news: Large-scale at Ottawa in Canada sinkhole, [http://www.yonhapnews.co.kr/bulletin/2016/06/09/0200000000](http://www.yonhapnews.co.kr/bulletin/2016/06/09/0200000000AKR20160609069000009.HTML)

425 [AKR20160609069000009.HTML](http://www.yonhapnews.co.kr/bulletin/2016/06/09/0200000000AKR20160609069000009.HTML), last access: December 2016.

426 Zarembski, A. M. and Palese, J. W.: Managing Risk on the Railway Infrastructure, 7<sup>th</sup> World Congress on Railway Research, 1-

427 7, 2006